

General Information

Date & Time: 16, Nov, 2024 14:32

Make	Toyota	Model	Hiace
YOM	2023	Mileage	10,068
Registration No.	NIK5091	Chassis No.	JTFJT02PXP5033971
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



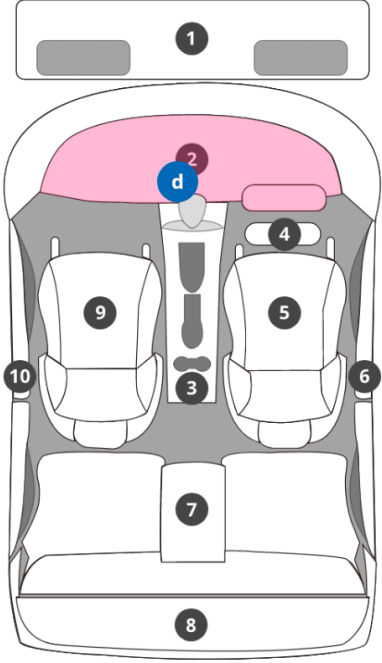
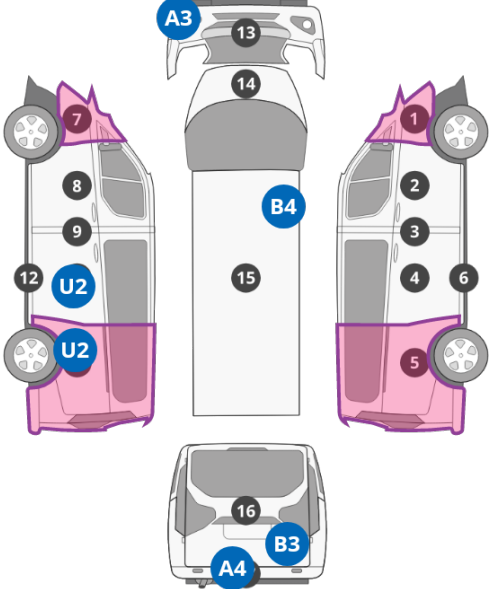
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	84.5	85	84	85
2	Boot Lid	74.9	72	80	73
3	Roof	72.5	83	70	64/74
4	Left Front Fender	77.2	74	78	80
5	Left Front Door	64.7	67	64	63
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	130.9	69	155	169
9	Right Front Fender	84.7	86	86	83
10	Right Front Door	78.8	108	64	64
11	Center Panel Right	75.9	80	77	71
12	Right Rear Door	69.7	74	69	66
13	Right Back Panel	148.2	186	184	75

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Worn as per age - Yes	Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Modified - Medium / Roof - Modified - Large / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Wheel, Cover - Cap Missing - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes / (L) Front Wheel, Cover - Cap Missing - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes	
no tools/ no warranty booklet/ no power mirror feature/ no reverse camera feature/ full body sticker	