

General Information

Date & Time: 08, Aug, 2025 10:56

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	53,234
Registration No.	NHA2068	Chassis No.	PA1B18F31P4219336
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



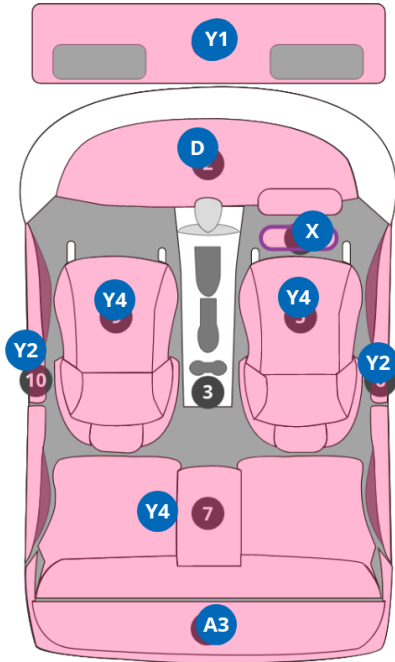
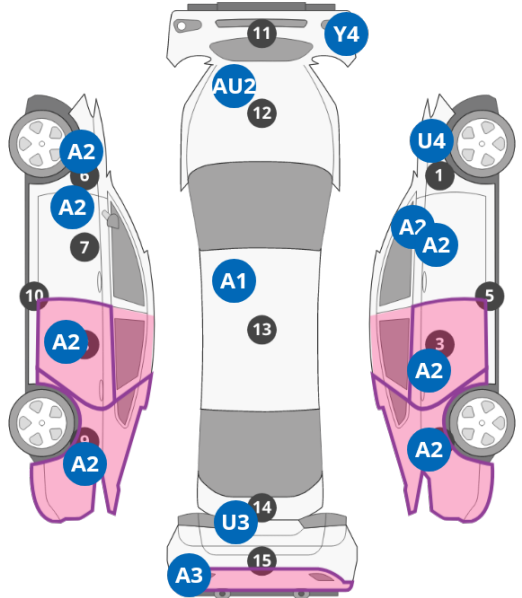
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	129	103	116
2	Boot Lid	115.6	110	111	126
3	Roof	112.2	111	105	126/107
4	Left Front Fender	108.3	108	105	112
5	Left Front Door	132.3	128	121	148
6	Center Panel Left				
7	Left Rear Door	132.0	134	128	134
8	Left Back Panel	184.3	187	195	171
9	Right Front Fender	110.3	117	103	111
10	Right Front Door	131.6	148	126	121
11	Center Panel Right				
12	Right Rear Door	154.0	171	137	154
13	Right Back Panel	204.0	148	293	171

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (L) Front Floor Mat - Missing - Yes / (L) Front Trim - Grime - Small / Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, loosed rear seat, stain on trunk hood, scratches on headlight and tail light.