

General Information

Date & Time: 16, Nov, 2024 16:38

Make	Toyota	Model	Vios
YOM	2024	Mileage	12,228
Registration No.	DBO6959	Chassis No.	PA1B18F3XR4256243
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



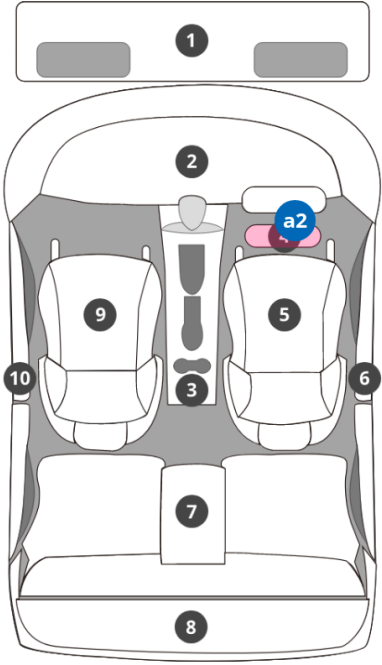
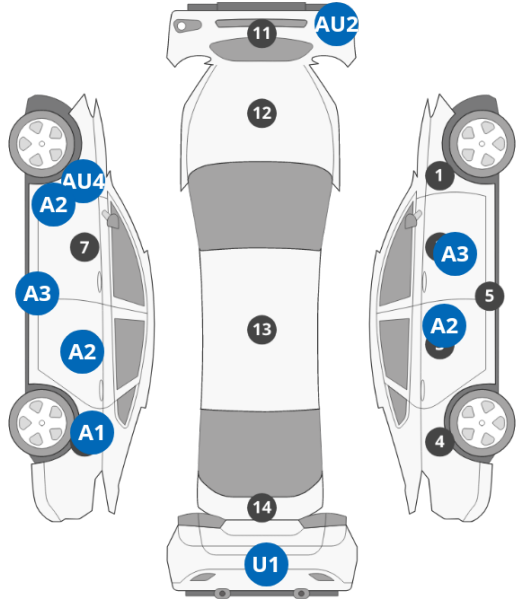
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	114	119	126
2	Boot Lid	111.3	112	110	112
3	Roof	103.5	105	101	101/107
4	Left Front Fender	107.0	107	105	109
5	Left Front Door	102.6	104	104	100
6	Center Panel Left				
7	Left Rear Door	106.3	107	106	106
8	Left Back Panel	107.6	111	107	105
9	Right Front Fender	107.0	105	105	111
10	Right Front Door	109.0	105	108	114
11	Center Panel Right				
12	Right Rear Door	113.3	113	115	112
13	Right Back Panel	102.6	103	102	103

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes
hairline scratches around the exterior. with warranty booklet and user manual. with tools.