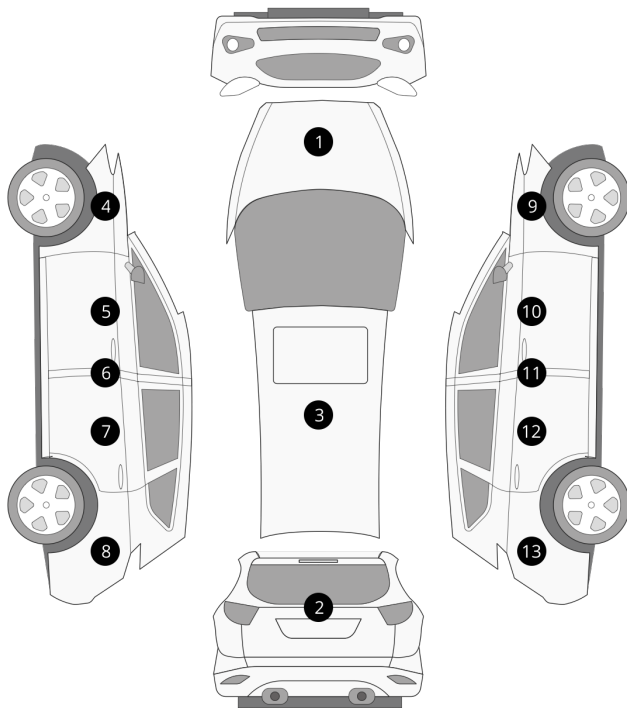


General Information

Date & Time: 11, Aug, 2025 13:14

Make	Toyota	Model	Avanza
YOM	2021	Odo Meter Reading	92,659
Registration No.	NGS4665	Chassis No.	MHKM5EF2FLK027700
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



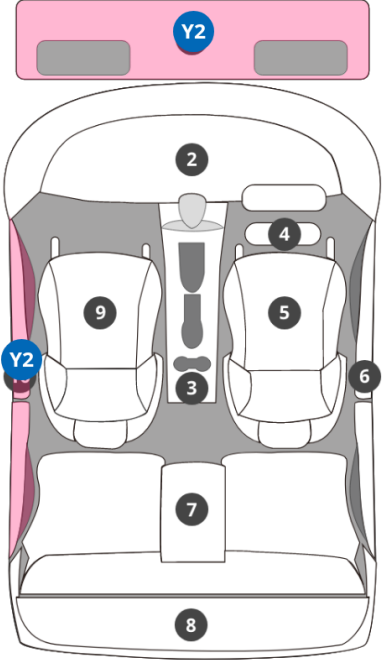
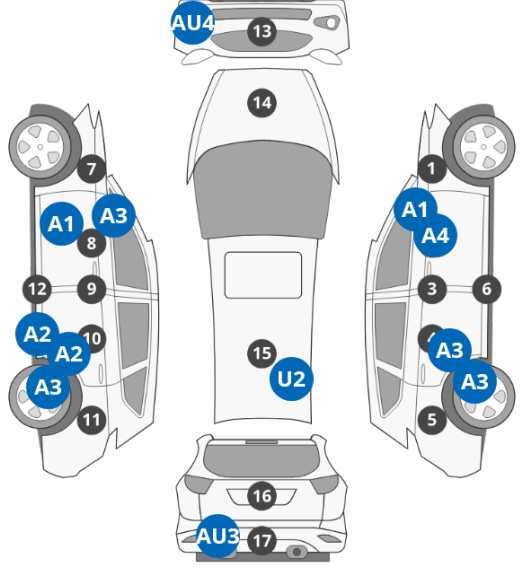
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	182.0	182	188	176
2	Boot Lid	242.3	264	249	214
3	Roof	161.7	154	147	194/152
4	Left Front Fender	162.3	155	161	171
5	Left Front Door	191.0	179	196	198
6	Center Panel Left				
7	Left Rear Door	181.6	194	182	169
8	Left Back Panel	155.3	169	150	147
9	Right Front Fender	161.0	171	155	157
10	Right Front Door	140.6	141	138	143
11	Center Panel Right				
12	Right Rear Door	166.3	141	203	155
13	Right Back Panel	162.0	159	170	157

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Mirror - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

Right parklight issue. Right plate light issue. With warranty booklet, spare tire and leather seat cover. Without jack and tools. 2 keys. With LTO plate.