

## General Information

Date & Time: 12, Aug, 2025 13:47

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	111,575
<b>Registration No.</b>	DAP3280	<b>Chassis No.</b>	PA1B18F30M4156533
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



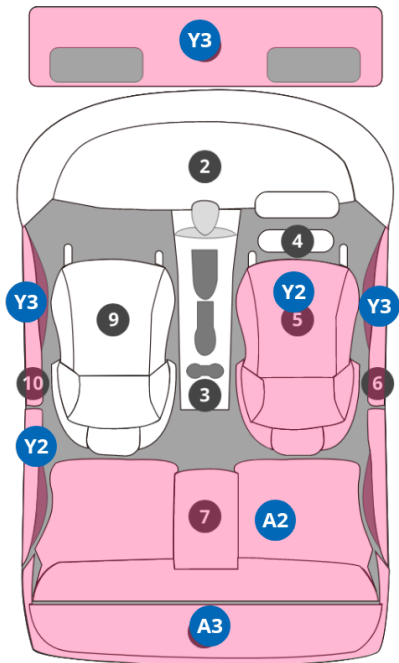
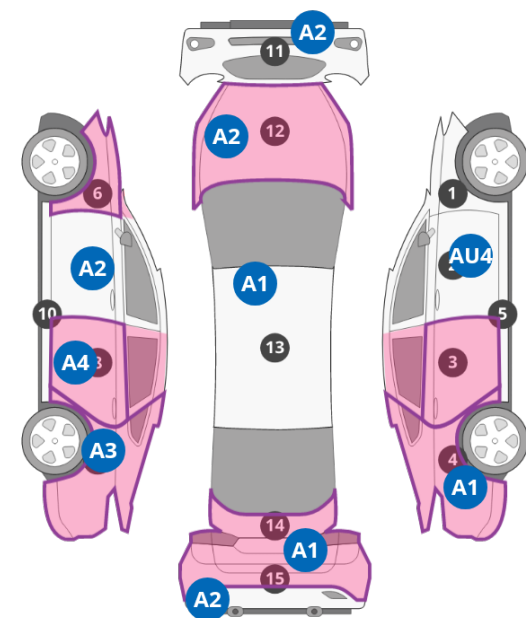
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	167.3	159	174	169
2	Boot Lid	388.6	152	828	186
3	Roof	137.2	140	141	134/134
4	Left Front Fender	142.0	128	148	150
5	Left Front Door	187.6	195	182	186
6	Center Panel Left				
7	Left Rear Door	206.0	218	188	212
8	Left Back Panel	275.6	191	283	353
9	Right Front Fender	206.0	205	198	215
10	Right Front Door	145.6	149	135	153
11	Center Panel Right				
12	Right Rear Door	148.6	161	139	146
13	Right Back Panel	156.0	140	139	189

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Cut, Crack - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / (L) Rear Trim - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Large / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with jack and incomplete tools/No warranty booklet/No spare key/Park light issue/rear seat issue/rear windshield blurred / irregular VS form with MMDA apprehension</p>