

General Information

Date & Time: 12, Aug, 2025 09:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	49,219
Registration No.	DBO7347	Chassis No.	PA1B18F33R4255774
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



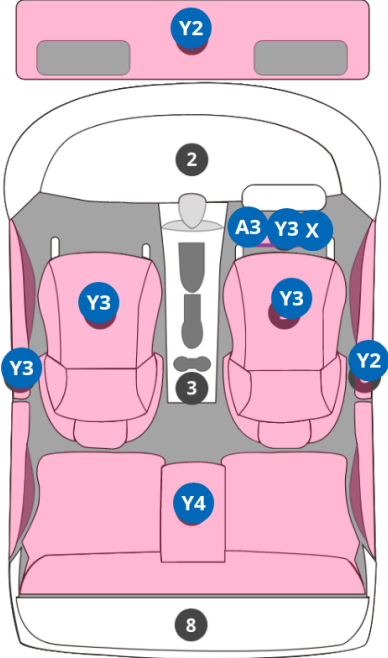
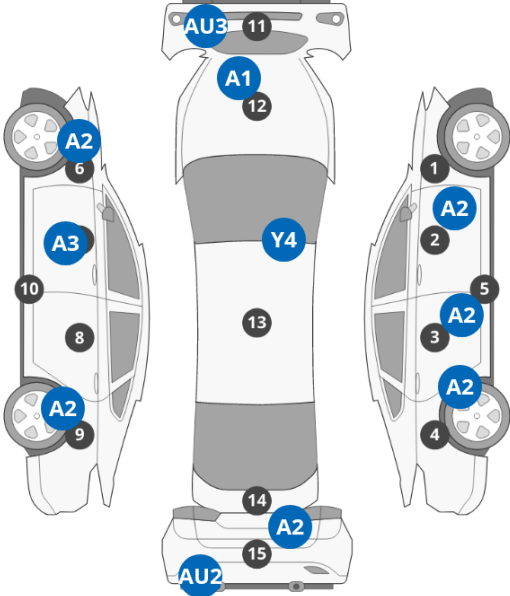
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	264.0	244	275	273
2	Boot Lid	137.0	136	131	144
3	Roof	139.7	150	148	137/124
4	Left Front Fender	260.0	289	265	226
5	Left Front Door	216.6	214	242	194
6	Center Panel Left				
7	Left Rear Door	222.6	229	222	217
8	Left Back Panel	141.6	145	143	137
9	Right Front Fender	258.6	258	266	252
10	Right Front Door	199.0	201	200	196
11	Center Panel Right				
12	Right Rear Door	214.0	199	211	232
13	Right Back Panel	130.6	133	129	130

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Front Windshield - Damaged - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Damaged front windshield. Without warranty booklet, jack and tools. With spare tire. 1 key. One LTO plate. One lost plate.</p>