

## General Information

Date & Time: 12, Aug, 2025 08:20

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	48,057
Registration No.	NDJ9514	Chassis No.	MK2XRNC1WKN042175
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Utility Vehicle
Colour	Silver		

## Body / Panel Condition



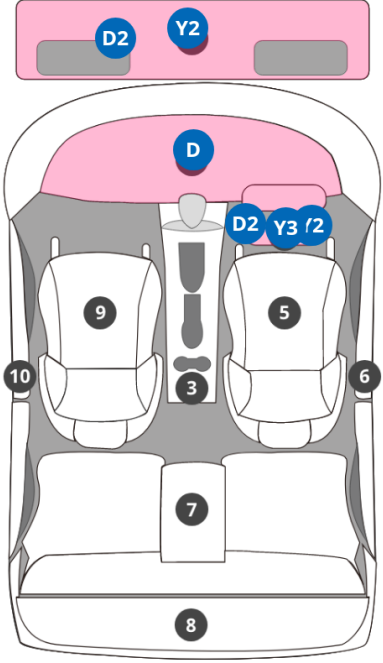
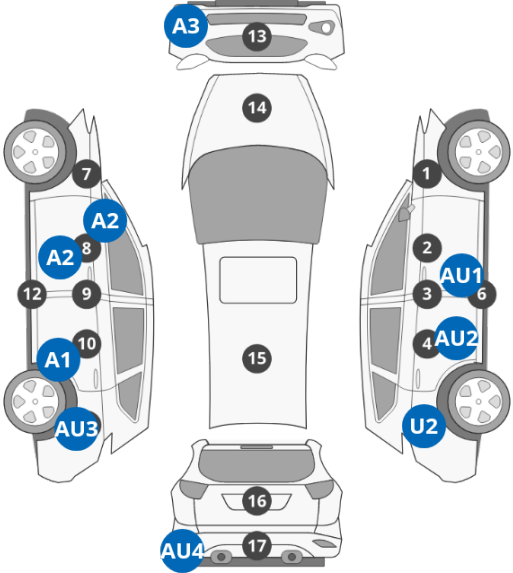
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.0	148	146	156
2	Boot Lid	125.0	125	135	115
3	Roof	141.7	167	141	136/123
4	Left Front Fender	135.3	134	141	131
5	Left Front Door	143.0	142	141	146
6	Center Panel Left				
7	Left Rear Door	137.0	145	136	130
8	Left Back Panel	145.0	156	146	133
9	Right Front Fender	141.6	146	140	139
10	Right Front Door	126.0	126	114	138
11	Center Panel Right				
12	Right Rear Door	118.0	116	113	125
13	Right Back Panel	130.6	129	133	130

**Overall Evaluation :**

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Sunvisor, Sunglass Holder - Crinkle - Small / Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Repair Mark - Yes / Mat Other - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (L) Mirror - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Routine Maintenance warning light. With warranty booklet, spare tire and leather seat cover. Without jack and tools. 1 key. With LTO plate.</p>