

General Information

Date & Time: 11, Aug, 2025 14:45

Make	Toyota	Model	Wigo
YOM	2019	Odo Meter Reading	90,355
Registration No.	NBE5545	Chassis No.	MHKA4DF5FJJ022956
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



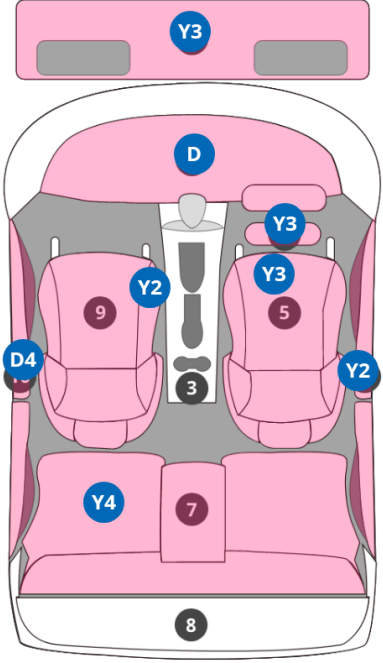
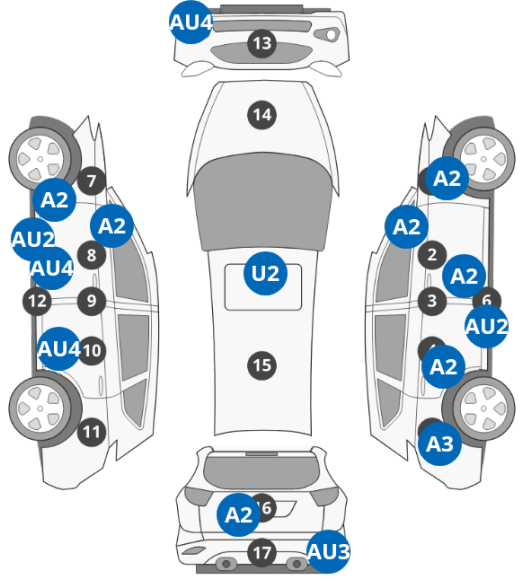
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.6	132	144	131
2	Boot Lid	220.0	254	235	171
3	Roof	116.9	123	135	110/100
4	Left Front Fender	136.6	132	141	137
5	Left Front Door	170.3	166	191	154
6	Center Panel Left				
7	Left Rear Door	140.0	146	138	136
8	Left Back Panel	126.0	130	124	124
9	Right Front Fender	145.6	152	145	140
10	Right Front Door	106.0	107	106	105
11	Center Panel Right				
12	Right Rear Door	108.6	110	109	107
13	Right Back Panel	121.6	130	118	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (L) Front Trim - Worked - Large / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

Transmission issue. Vehicle cannot reverse properly. Check engine and transmission warning lamp. Right plate light issue. Without warranty booklet,jack,tools and seat cover. With spare tire. 1 key. With LTO plate.