

General Information

Date & Time: 18, Aug, 2025 12:55

Make	Toyota	Model	Veloz
YOM	2023	Odo Meter Reading	10,373
Registration No.	NKG4188	Chassis No.	MHFAB1BY2N3039657
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



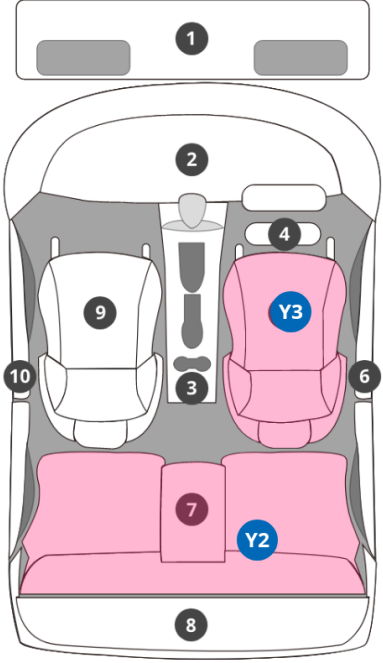
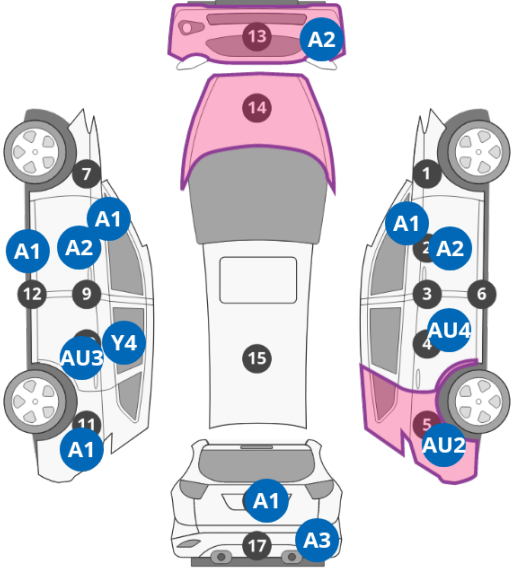
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	208.3	207	206	212
2	Boot Lid	118.0	114	135	105
3	Roof	119.5	129	133	102/114
4	Left Front Fender	121.6	115	126	124
5	Left Front Door	131.0	130	125	138
6	Center Panel Left				
7	Left Rear Door	125.0	134	119	122
8	Left Back Panel	136.0	163	120	125
9	Right Front Fender	116.0	117	119	112
10	Right Front Door	126.0	130	119	129
11	Center Panel Right				
12	Right Rear Door	133.0	144	125	130
13	Right Back Panel	149.0	147	135	165

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium</p>	<p>Remarks Bonnet - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Partially Missing - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Side Window - Damaged - Large</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/left side rear door issue/with warranty booklet/with reverse camera/No spare key/No jack and tools/right side rear fender small parts missing</p>