

## General Information

Date & Time: 19, Aug, 2025 10:08

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	25,132
<b>Registration No.</b>	NHM5437	<b>Chassis No.</b>	MHFAA1BY5P0021905
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Green		

## Body / Panel Condition



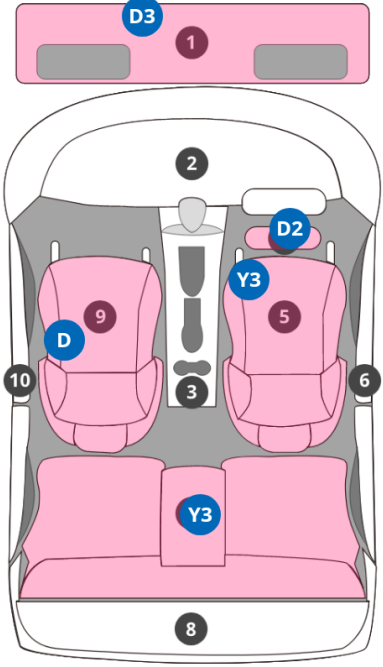
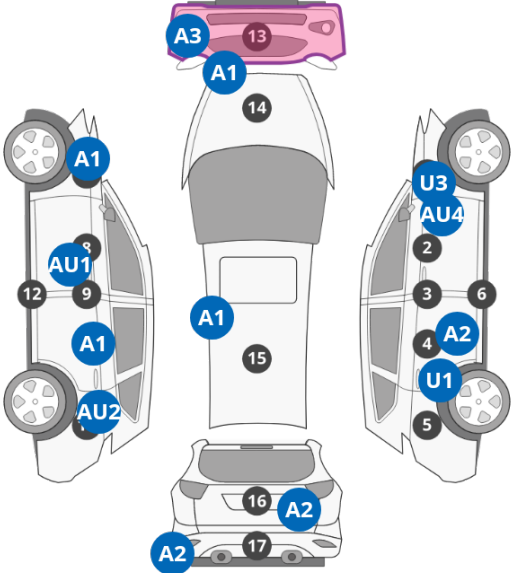
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	121	122	119
2	Boot Lid	109.3	109	118	101
3	Roof	128.5	132	145	117/120
4	Left Front Fender	107.0	107	108	106
5	Left Front Door	254.3	160	160	443
6	Center Panel Left				
7	Left Rear Door	220.0	288	217	155
8	Left Back Panel	127.3	128	111	143
9	Right Front Fender	103.3	107	101	102
10	Right Front Door	116.3	122	112	115
11	Center Panel Right				
12	Right Rear Door	114.0	119	113	110
13	Right Back Panel	118.0	127	105	122

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Crinkle - Medium	<b>Remarks</b> (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Spare Key - Issue - Unexist

<b>Inspector Notes</b>
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, Irregular VS Form / MMDA Violation