

## General Information

Date & Time: 19, Aug, 2025 08:49

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	7,948
<b>Registration No.</b>	NHU6999	<b>Chassis No.</b>	MHFAA1BY5R0030431
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Black		

## Body / Panel Condition



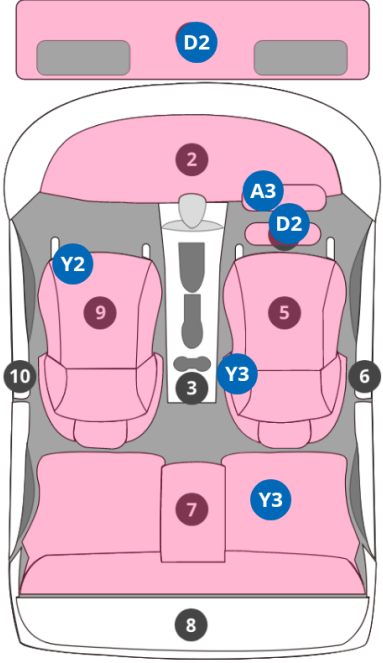
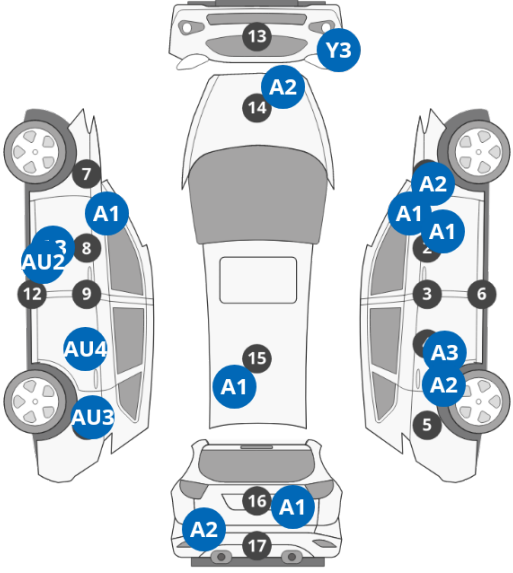
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	104	109	111
2	Boot Lid	101.1	103	112	88
3	Roof	119.2	130	122	121/104
4	Left Front Fender	95.3	95	94	97
5	Left Front Door	110.0	107	105	118
6	Center Panel Left				
7	Left Rear Door	113.3	107	125	108
8	Left Back Panel	120.3	116	103	142
9	Right Front Fender	102.7	98	108	102
10	Right Front Door	114.0	128	106	108
11	Center Panel Right				
12	Right Rear Door	115.6	123	107	117
13	Right Back Panel	121.0	133	106	124

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Glove Box - Worn, Scratch, Cut, Crack - Medium / Ceiling - Crinkle - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack and tools, with spare tire, no LTO plate, scratches on tail light</p>