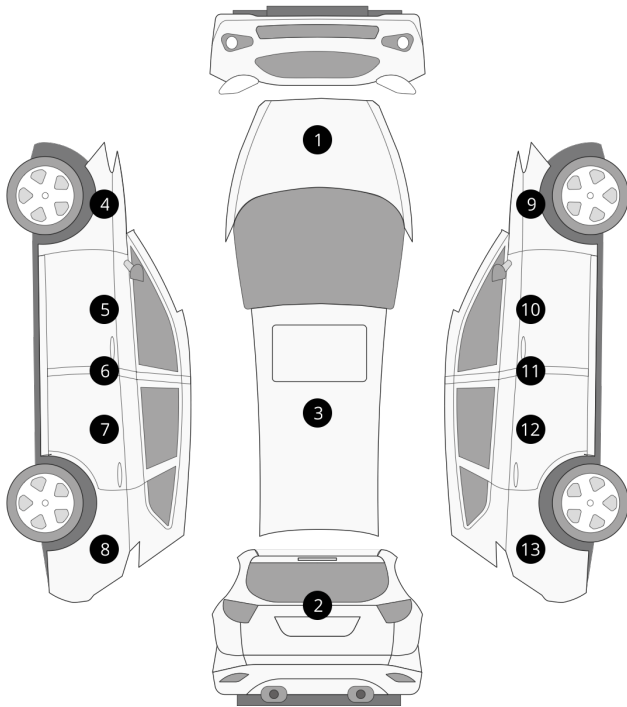


## General Information

Date & Time: 19, Aug, 2025 12:41

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	58,656
<b>Registration No.</b>	NIO4823	<b>Chassis No.</b>	PA1B18F36P4235581
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



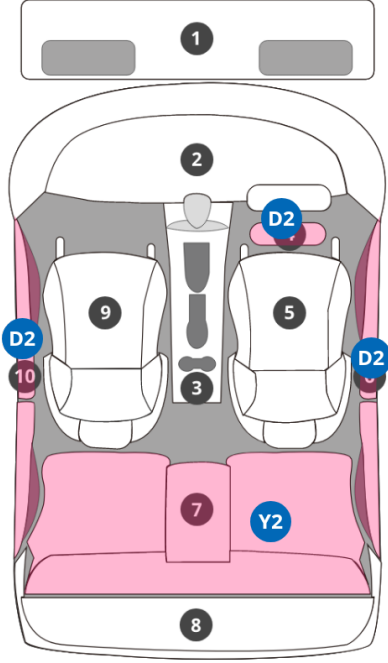
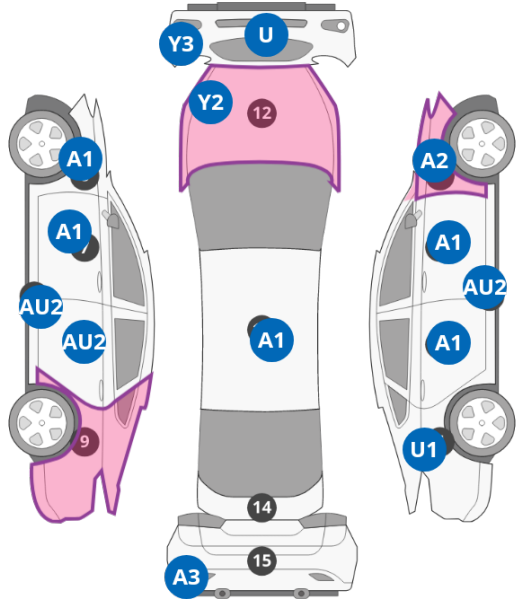
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.0	129	136	131
2	Boot Lid	119.0	111	117	129
3	Roof	107.7	106	111	106/108
4	Left Front Fender	103.3	104	102	104
5	Left Front Door	113.3	107	106	127
6	Center Panel Left				
7	Left Rear Door	164.3	154	170	169
8	Left Back Panel	171.0	190	167	156
9	Right Front Fender	209.6	161	256	212
10	Right Front Door	117.6	129	112	112
11	Center Panel Right				
12	Right Rear Door	111.3	105	105	124
13	Right Back Panel	115.6	123	114	110

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Minimal / Bonnet, Headlight - Repair mark - Yes / Roof - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Crack, Gap - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and warranty booklet and Sparetire and Jack, Incomplete Tools. Crack and scratch headlight and tail light. worn tires and Sparetire, adhesive marks on vehicle.</p>