

General Information

Date & Time: 19, Aug, 2025 09:51

Make	Toyota	Model	Veloz
YOM	2024	Odo Meter Reading	66,978
Registration No.	NIR8091	Chassis No.	MHFAB1BY2P3068420
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



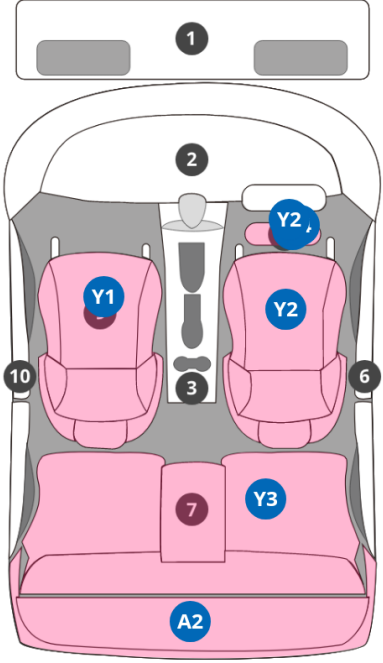
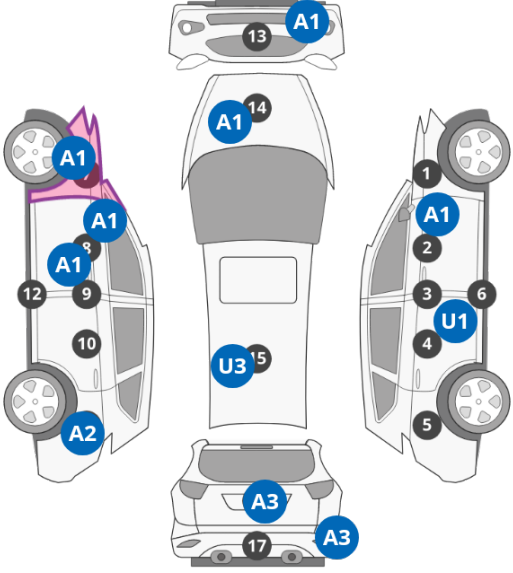
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.0	103	95	102
2	Boot Lid	103.6	100	107	104
3	Roof	109.2	114	119	98/106
4	Left Front Fender	293.6	149	128	604
5	Left Front Door	118.6	105	124	127
6	Center Panel Left				
7	Left Rear Door	121.0	118	114	131
8	Left Back Panel	140.6	165	146	111
9	Right Front Fender	97.7	96	101	96
10	Right Front Door	118.0	124	122	108
11	Center Panel Right				
12	Right Rear Door	119.0	128	112	117
13	Right Back Panel	123.3	122	114	134

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Large / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / Roof - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with warranty booklet/with jack and incomplete tools/head unit issue/reverse camera not function/No spare key/left side mirror issue/ audio radio not function/handbrake issue</p>