

## General Information

Date & Time: 18, Aug, 2025 12:18

<b>Make</b>	Toyota	<b>Model</b>	Hiace
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	201,629
<b>Registration No.</b>	EAG1221	<b>Chassis No.</b>	JTFNAFAP9N8026738
<b>CC</b>	2.8	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	Silver		

## Body / Panel Condition



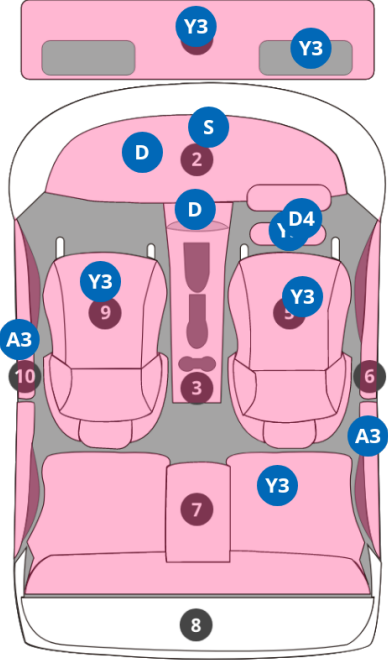
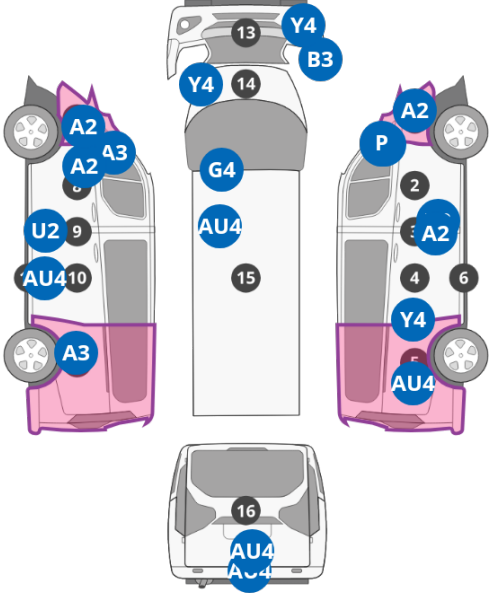
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	170.3	167	166	178
2	Boot Lid	100.0	101	98	101
3	Roof	99.1	111	113	87/85
4	Left Front Fender	98.2	93	102	100
5	Left Front Door	104.0	115	100	97
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	99.4	100	94	105
9	Right Front Fender	434.3	460	459	384
10	Right Front Door	263.3	220	465	105
11	Center Panel Right	172.6	143	191	184
12	Right Rear Door	172.0	178	168	170
13	Right Back Panel	202.6	198	196	214

## Overall Evaluation :

**E**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Medium / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / (L) Rear Trim - Cut, Crack - Medium / (R) Rear Trim - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Modified - Medium / Overall Exterior - Re-Paint Uneven - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Stuck - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Crack, Gap - Medium / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Center Panel - Dent - Small / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Large / Front Windshield - Scratch, Stone chip - Large / Roof - Scratch &amp; Dent - Large / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes / (L) Front Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>C</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Reverse Camera - N/A - Yes</p>

**Inspector Notes**

with warranty booklet, no jack and tools, with spare tire and LTO PLATE, scratched and cracked headlight and tail light, possible flooded, cracked front windshield, sliding door railings issue, rear door won't open, door lock issue, adhesive mark on ceiling, right side mirror stuck and repaired and modified, right side part of vehicle repainted un-even, airbag warning lamp on, retractable mirror issue, worn tires