

General Information

Date & Time: 18, Aug, 2025 10:41

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	103,095
Registration No.	NFI3178	Chassis No.	PA1B18F38M4159213
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



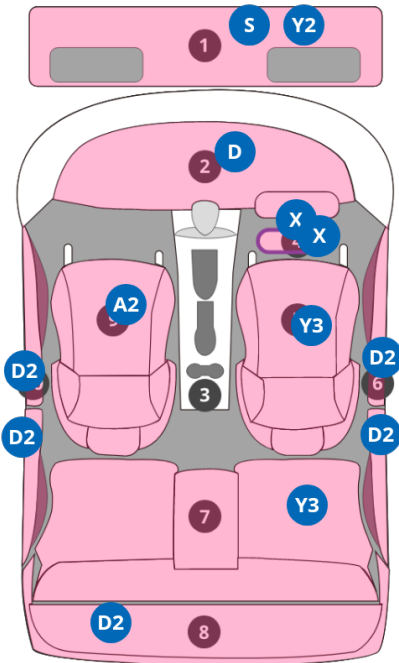
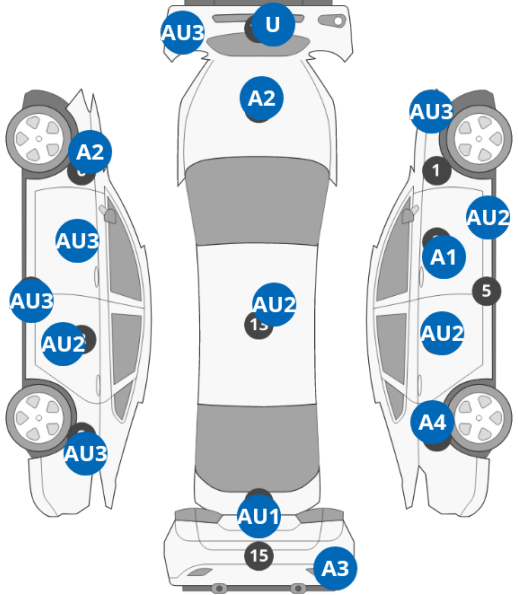
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	109	106	119
2	Boot Lid	113.0	112	109	118
3	Roof	99.4	113	97	85/103
4	Left Front Fender	96.8	101	98	92
5	Left Front Door	99.8	101	101	98
6	Center Panel Left				
7	Left Rear Door	99.0	98	98	101
8	Left Back Panel	115.0	117	114	114
9	Right Front Fender	95.0	96	89	100
10	Right Front Door	97.3	99	97	95
11	Center Panel Right				
12	Right Rear Door	98.6	99	99	98
13	Right Back Panel	108.0	103	102	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Cut, Crack - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Switchs - Stuck - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small / Trunk Room - Loose, Deformed - Small</p>		<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>	

Inspector Notes
<p>With LTO plate and Sparetire and Incomplete Tools,Jack. No warranty booklet, scratch headlight and tail light and Crack Tail light, possible flooded, camera not working. Worn tires and Sparetire.</p>