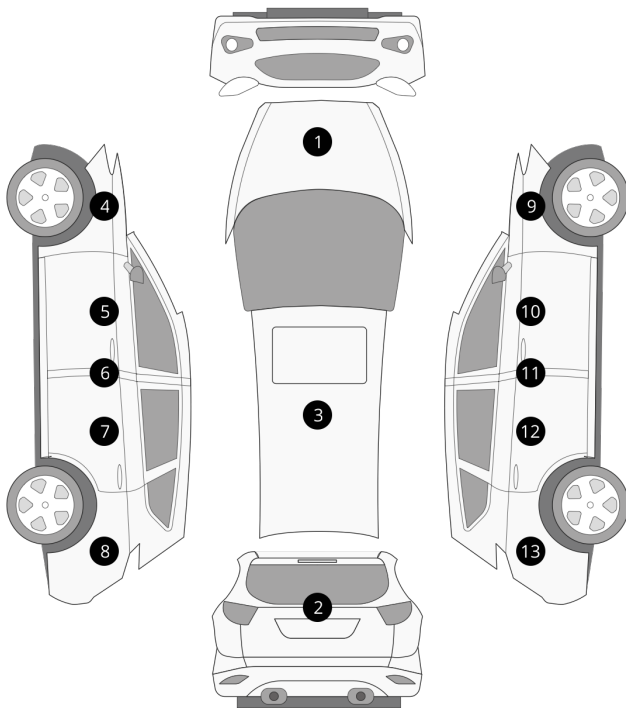


## General Information

Date & Time: 15, Aug, 2025 15:59

<b>Make</b>	Nissan	<b>Model</b>	Almera
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	20,117
<b>Registration No.</b>	LAI1278	<b>Chassis No.</b>	BDUALBAN17C59609
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



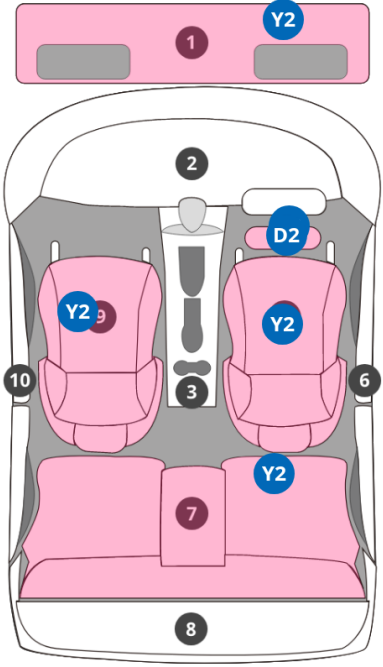
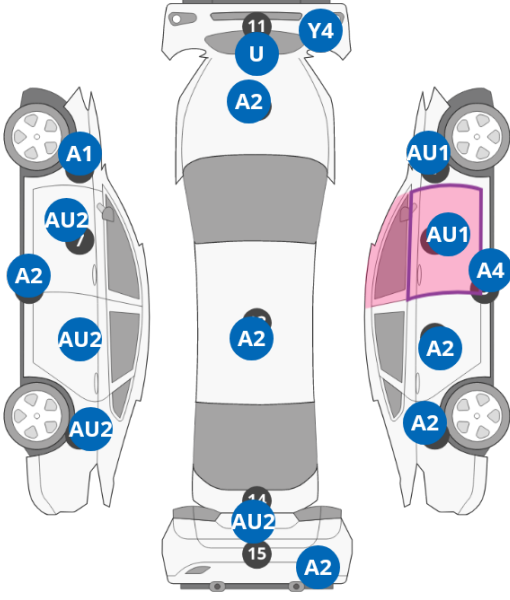
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>134.3</b>	132	137	134
2	Boot Lid	<b>98.2</b>	90	85	120
3	Roof	<b>132.5</b>	129	131	131/139
4	Left Front Fender	<b>131.3</b>	108	140	146
5	Left Front Door	<b>108.5</b>	96	102	128
6	Center Panel Left				
7	Left Rear Door	<b>122.6</b>	126	108	134
8	Left Back Panel	<b>151.3</b>	192	134	128
9	Right Front Fender	<b>155.3</b>	156	156	154
10	Right Front Door	<b>173.3</b>	179	168	173
11	Center Panel Right				
12	Right Rear Door	<b>140.0</b>	119	108	193
13	Right Back Panel	<b>133.6</b>	125	122	154

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and Sparetire and Jack, Incomplete Tools. No warranty booklet and scratch headlight and tail light. Tow hook cover missing.</p>