

## General Information

Date & Time: 25, Nov, 2024 10:54

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Mileage</b>	29,028
<b>Registration No.</b>	DBN5755	<b>Chassis No.</b>	PA1B18F33P4232198
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



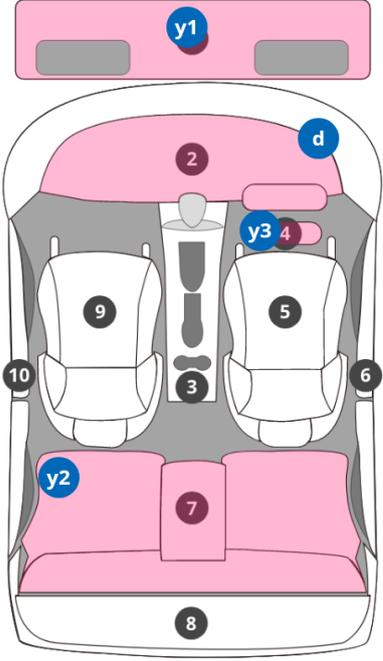
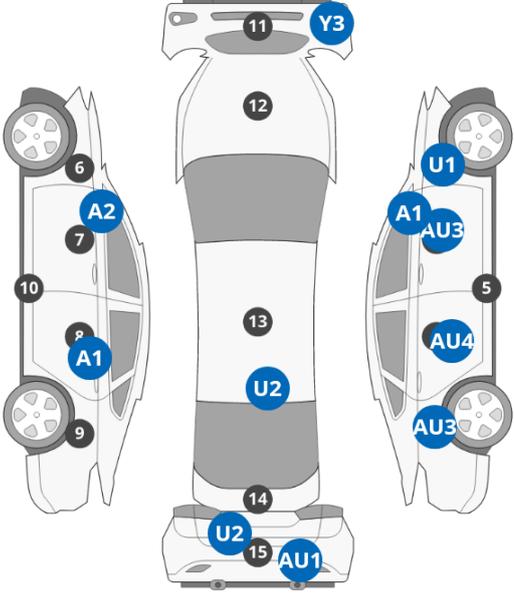
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	117	104	107
2	Boot Lid	109.0	108	107	112
3	Roof	106.0	100	100	110/114
4	Left Front Fender	100.3	102	102	97
5	Left Front Door	97.8	97	100	97
6	Center Panel Left				
7	Left Rear Door	100.3	102	98	101
8	Left Back Panel	112.3	116	113	108
9	Right Front Fender	99.6	100	102	97
10	Right Front Door	101.6	103	102	100
11	Center Panel Right				
12	Right Rear Door	97.4	96	97	99
13	Right Back Panel	104.4	97	100	116

Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Dent - Minimal / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>swirlmarks and hairline scratches around the exterior. with tools and user manual. No warranty booklet.</p>