

## General Information

Date & Time: 25, Nov, 2024 13:20

Make	Toyota	Model	Vios
YOM	2023	Mileage	61,699
Registration No.	DBG4705	Chassis No.	PA1B18F38P4200301
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

## Body / Panel Condition



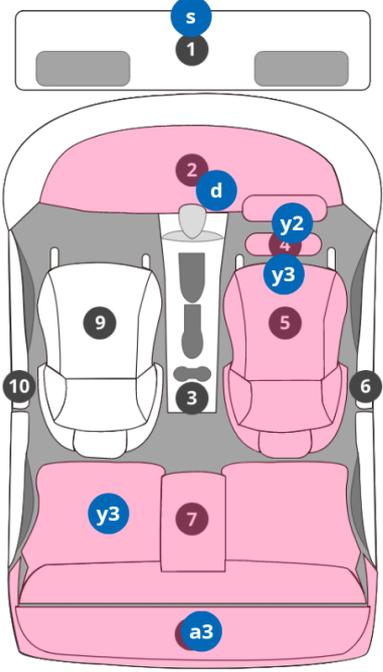
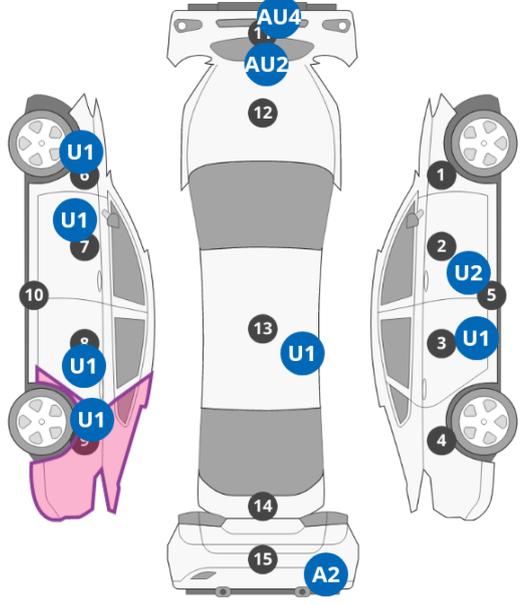
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	109	115	115
2	Boot Lid	110.3	105	113	113
3	Roof	99.9	104	96	99/100
4	Left Front Fender	98.2	95	100	100
5	Left Front Door	104.6	101	105	108
6	Center Panel Left				
7	Left Rear Door	105.6	108	109	100
8	Left Back Panel	109.3	109	104	115
9	Right Front Fender	97.0	97	105	89
10	Right Front Door	98.8	105	97	95
11	Center Panel Right				
12	Right Rear Door	101.2	99	97	107
13	Right Back Panel	105.6	100	103	114

Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium</p>	<p><b>Remarks</b> Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Dent - Minimal / (R) Front Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Dent - Minimal / (L) Front Fender, Molding - Dent - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Rear Door, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Roof - Dent - Minimal / (L) Rear Wheel, Cover - Cap Missing - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with spare tire/warranty booklets/jack/incomplete tools/dirty carpet/dirty trunk room/reverse camera not function/driver window not function/worn tire</p>