

General Information

Date & Time: 20, Aug, 2025 15:34

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	17,890
Registration No.	NHG2134-1	Chassis No.	PA1B18F30P4233440
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



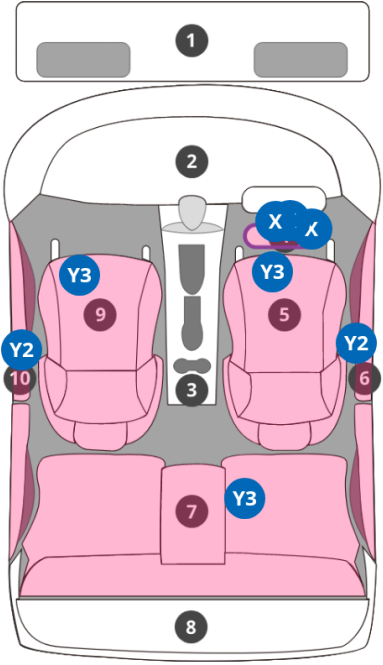
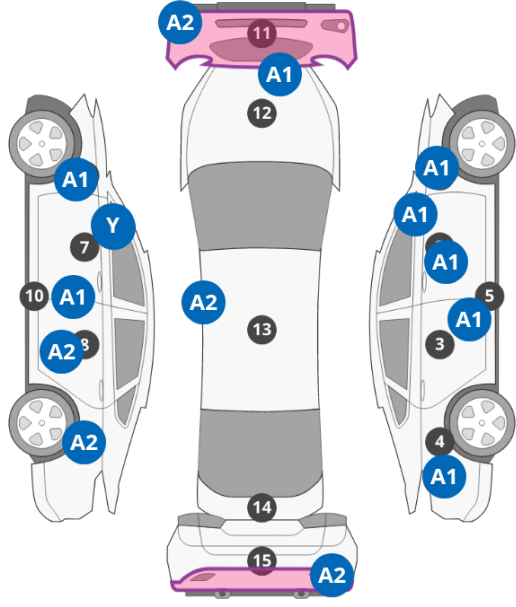
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	114	109	119
2	Boot Lid	190.6	357	102	113
3	Roof	99.9	107	100	96/97
4	Left Front Fender	94.6	93	91	100
5	Left Front Door	332.6	293	150	555
6	Center Panel Left				
7	Left Rear Door	102.5	114	99	95
8	Left Back Panel	110.3	123	106	102
9	Right Front Fender	184.0	185	187	180
10	Right Front Door	111.3	114	113	107
11	Center Panel Right				
12	Right Rear Door	104.1	97	99	116
13	Right Back Panel	104.0	99	100	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Mirror - Crack - Cracks / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, no spare tire, no LTO plate, scratches on tail light, cracked left side mirror, HPG Recovered unit/ Towed unit</p>