

General Information

Date & Time: 03, Dec, 2024 17:50

Make	Toyota	Model	Vios
YOM	2021	Mileage	102,012
Registration No.	NGR8101	Chassis No.	PA1B18F36L4131845
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



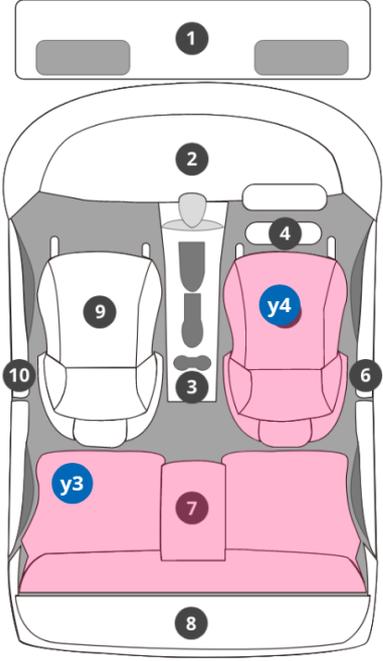
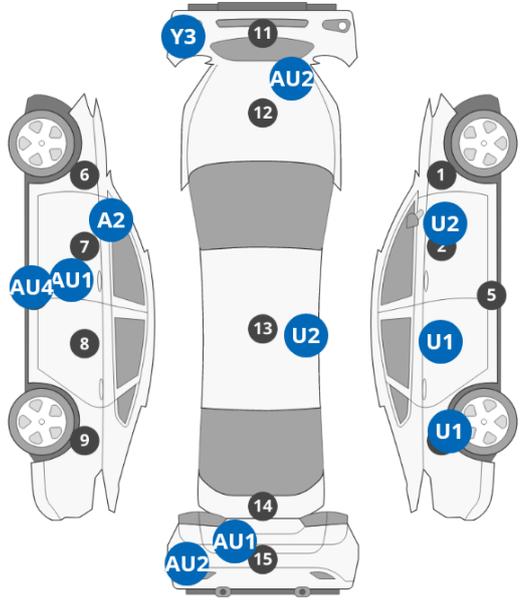
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	148.3	137	156	152
2	Boot Lid	99.6	97	100	102
3	Roof	93.6	105	85	94/90
4	Left Front Fender	97.4	103	94	95
5	Left Front Door	129.0	143	122	122
6	Center Panel Left				
7	Left Rear Door	91.8	93	92	91
8	Left Back Panel	100.6	102	100	100
9	Right Front Fender	87.9	87	90	87
10	Right Front Door	86.3	82	84	93
11	Center Panel Right				
12	Right Rear Door	91.3	94	91	89
13	Right Back Panel	94.8	92	94	99

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Large</p>	<p>Remarks Bonnet - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Rear Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Dent - Minimal / Roof - Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>left highbeam, parklight and hazard light. bulb loose not in the right location. indoor dim light left front loose. hairline scratches around the exterior. with manual and tools. no warranty booklet.</p>