

General Information

Date & Time: 11, Jul, 2026 14:50

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	68,856
Registration No.	DAP4259	Chassis No.	JTFJT02P2M5028162
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



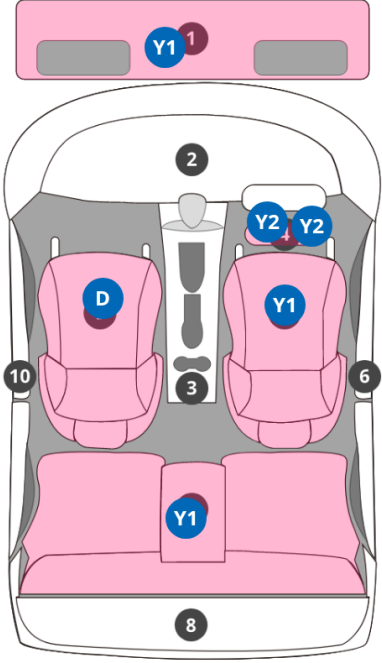
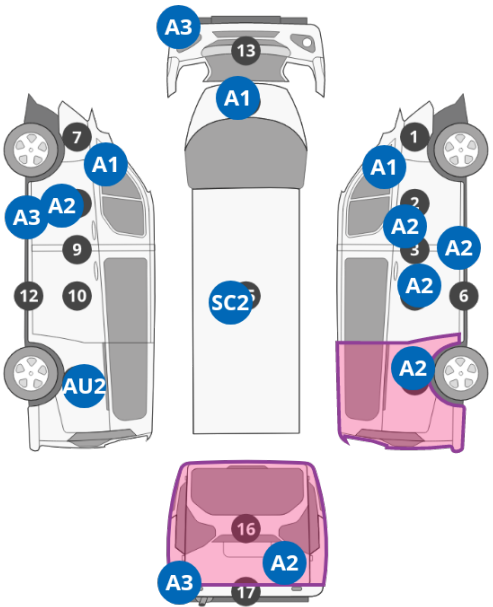
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	123	125	112
2	Boot Lid	149.6	147	155	147
3	Roof	112.5	108	106	117/119
4	Left Front Fender	119.0	127	113	117
5	Left Front Door	106.6	106	107	107
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	114.3	108	105	130
9	Right Front Fender	126.0	118	136	124
10	Right Front Door	106.6	107	100	113
11	Center Panel Right	115.3	121	122	103
12	Right Rear Door	128.3	128	117	140
13	Right Back Panel	560.6	928	347	407

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Scratch - Minimal / Roof - Rust, Corrosion - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/no tools and jack/with spare tire/battery weak/front bumper partially missing/door lock issue/no spare key/scratches on taillight cover/with seat cover/hairline scratches on the body/bypass fog light/abnormal noise/no wiper blade