

## General Information

Date & Time: 01, Sep, 2025 10:32

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	29,831
<b>Registration No.</b>	NIF8208	<b>Chassis No.</b>	MRAB8DD5N145265
<b>CC</b>	2.4	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Green		

## Body / Panel Condition



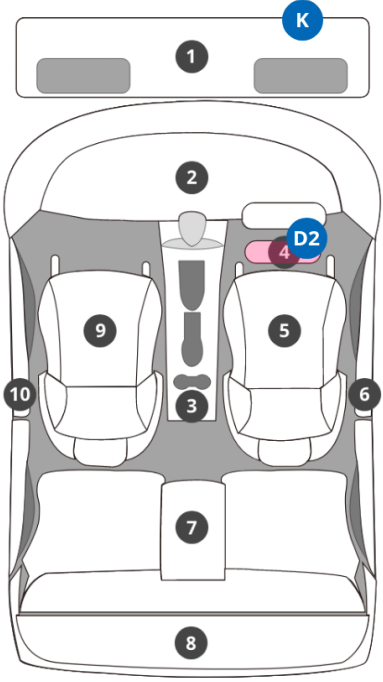
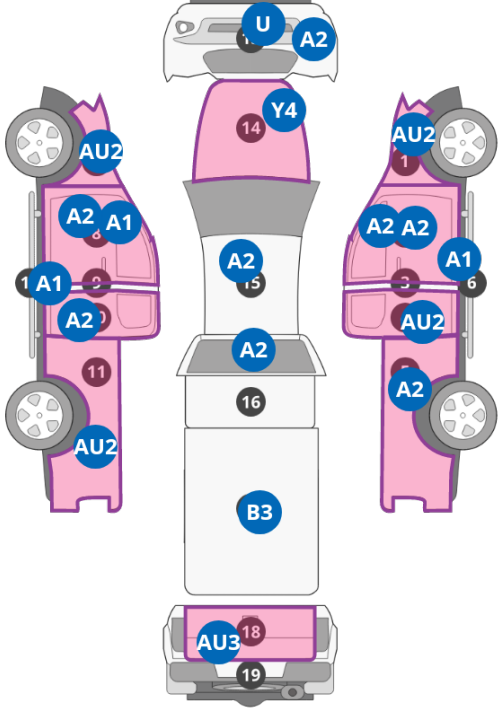
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	384.6	204	548	402
2	Boot Lid	92.1	95	90	92
3	Roof	134.8	97	100	171/172
4	Left Front Fender	221.3	178	310	176
5	Left Front Door	155.3	159	154	153
6	Center Panel Left				
7	Left Rear Door	144.6	156	137	141
8	Left Back Panel	221.0	133	340	190
9	Right Front Fender	159.3	175	140	163
10	Right Front Door	156.6	162	134	174
11	Center Panel Right				
12	Right Rear Door	352.3	147	750	160
13	Right Back Panel	226.0	146	148	384

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Crinkle - Small	<b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Side Gate - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Bonnet, Headlight - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Small / (L) Side Gate - Scratch & Dent - Small / Rear Gate - Partially Missing - Yes / Rear Gate - Scratch & Dent - Medium / Cab Back Panel - Scratch - Small / Cargo Bed Floor - Modified - Medium / Roof - Scratch - Small
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Warning Lamps - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

**Inspector Notes**

With LTO Plate, Warranty Booklet and Jack, Incomplete Tools, Scratch Head light And Tail Light, Warning Lamps On, Modified Hole on cargo bed. Worn Spare tire and Tires. Partially missing parts on rear door, Horn issue, No spare key.