

General Information

Date & Time: 10, Sep, 2025 15:58

Make	Toyota	Model	Hilux
YOM	2013	Odo Meter Reading	414,877
Registration No.	UPO978	Chassis No.	MR0ER320K86928674
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



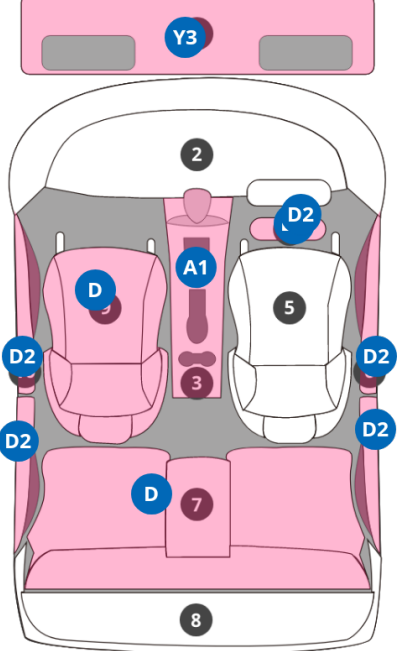
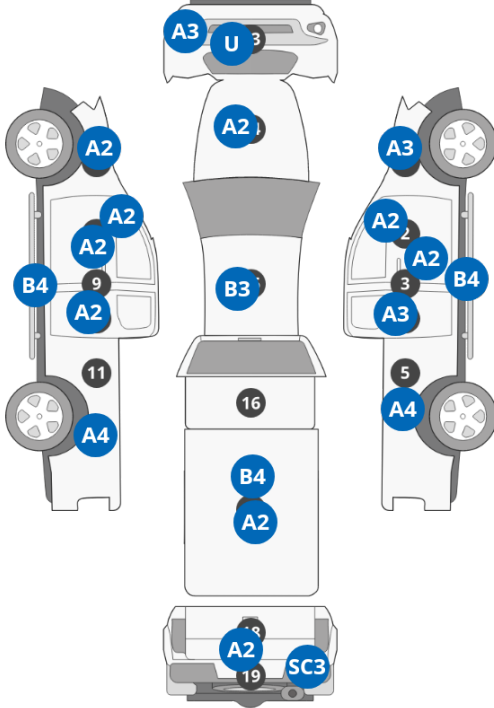
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	164.6	163	170	161
2	Boot Lid	166.0	153	173	172
3	Roof	166.0	187	153	159/165
4	Left Front Fender	166.6	169	171	160
5	Left Front Door	176.6	166	191	173
6	Center Panel Left	201.6	259	155	191
7	Left Rear Door	196.3	167	259	163
8	Left Back Panel	153.0	150	137	172
9	Right Front Fender	177.6	171	187	175
10	Right Front Door	193.0	270	164	145
11	Center Panel Right	254.3	243	313	207
12	Right Rear Door	181.3	169	164	211
13	Right Back Panel	167.0	175	176	150

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Worn - Yes / Ceiling - Grime - Medium / Overall Interior - Worn as per age - Yes / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Worked - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small / (L) Rear Trim - Worked - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Center Panel - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Cargo Bed Floor - Modified - Large / Cargo Bed Floor - Scratch - Small / Member (Bolted) - Dent - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Worn as per age - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Modified - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Large / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Rust, Corrosion - Medium / Roof - Modified - Medium / (L) Side Gate - Scratch - Large / (L) Step, In-panel, Side Spoiler - Modified - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : D
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, no jack and tools, with spare tire, faded headlights, damaged tail light, busted plate light, battery fluid leak</p>