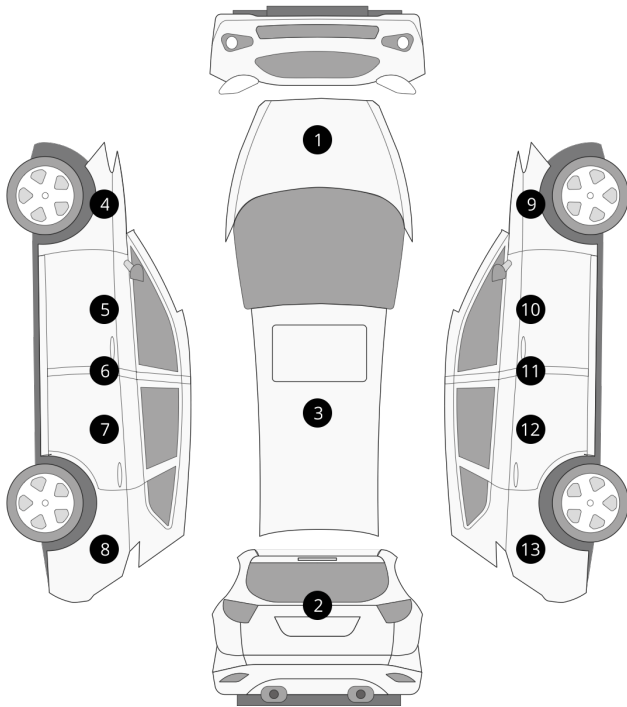


## General Information

Date & Time: 04, Sep, 2025 13:32

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	27,910
<b>Registration No.</b>	NFI2232	<b>Chassis No.</b>	PA1B18F34M4147463
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	White		

## Body / Panel Condition



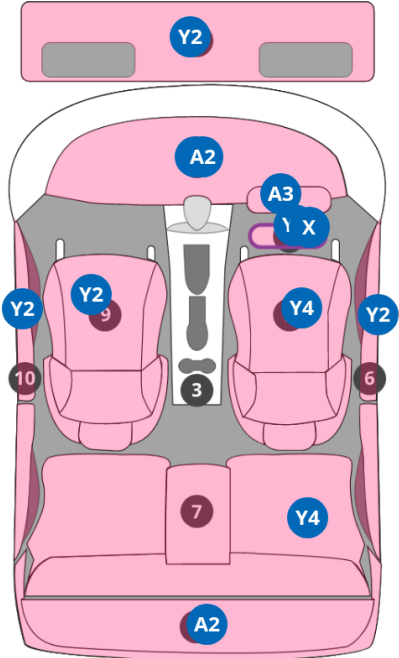
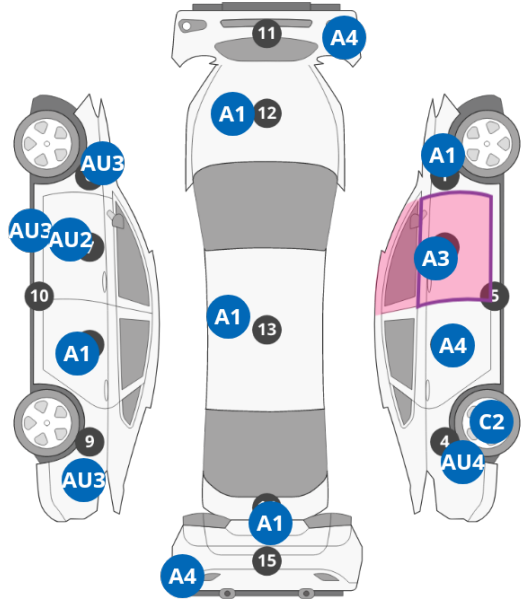
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	116	127	127
2	Boot Lid	124.3	126	119	128
3	Roof	105.7	106	104	105/108
4	Left Front Fender	109.3	112	105	111
5	Left Front Door	106.3	109	103	107
6	Center Panel Left				
7	Left Rear Door	111.3	121	107	106
8	Left Back Panel	123.0	130	122	117
9	Right Front Fender	116.6	123	114	113
10	Right Front Door	177.0	180	166	185
11	Center Panel Right				
12	Right Rear Door	115.6	108	114	125
13	Right Back Panel	119.0	115	115	127

Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Mat Other - Missing - Yes	<b>Remarks</b> (R) Front Door - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Wheel, Cover - Scratch, Corrosion - Small
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate/with spare tire/with jack/ No tools/No reverse camera/with warranty booklet/possible flooding/No spare key