

## General Information

Date & Time: 09, Sep, 2025 10:44

<b>Make</b>	Suzuki	<b>Model</b>	Dzire
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	46,684
<b>Registration No.</b>	NIU5207	<b>Chassis No.</b>	MBHZF63S6RG468741
<b>CC</b>	1.2	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



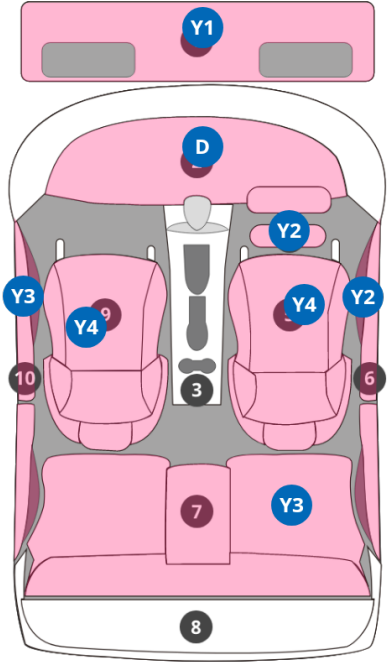
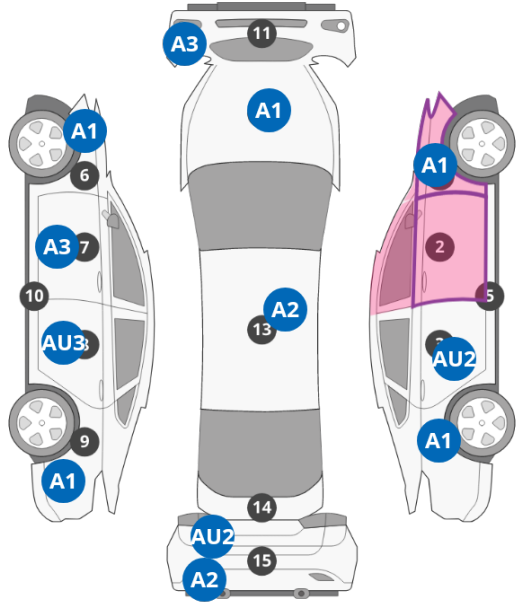
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.4	103	103	98
2	Boot Lid	86.7	89	83	89
3	Roof	102.5	95	97	105/114
4	Left Front Fender	118.0	123	119	112
5	Left Front Door	101.2	104	100	100
6	Center Panel Left				
7	Left Rear Door	93.0	101	91	87
8	Left Back Panel	101.0	100	109	95
9	Right Front Fender	760.0	210	816	1,254
10	Right Front Door	204.3	141	144	328
11	Center Panel Right				
12	Right Rear Door	100.0	97	97	107
13	Right Back Panel	106.0	101	105	112

Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/With warranty booklet/with spare tire/with spare key/with jack and incomplete tools/with LTO Apprehension /Manual transmission/No reverse camera</p>