

General Information

Date & Time: 08, Sep, 2025 13:41

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	3,222
Registration No.	NFS8947	Chassis No.	PA1B18F34R4243715
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



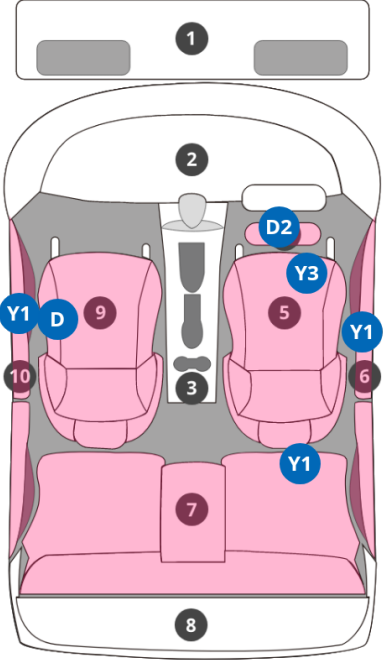
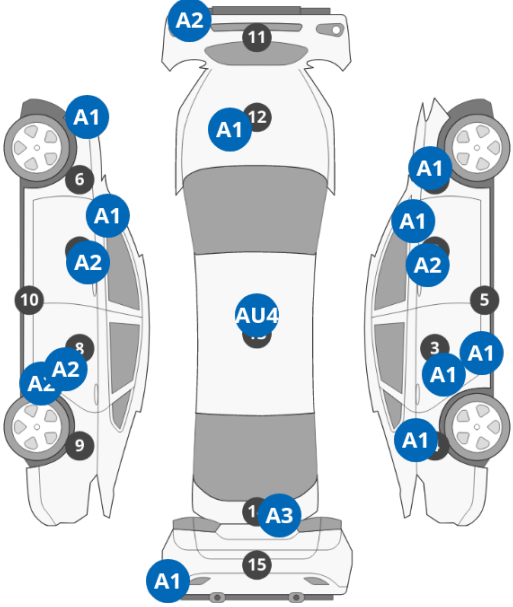
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.0	146	108	151
2	Boot Lid	109.0	104	109	114
3	Roof	110.5	123	109	103/107
4	Left Front Fender	150.6	178	129	145
5	Left Front Door	140.3	144	140	137
6	Center Panel Left				
7	Left Rear Door	108.3	110	113	102
8	Left Back Panel	110.0	115	108	107
9	Right Front Fender	204.0	251	164	197
10	Right Front Door	190.3	225	175	171
11	Center Panel Right				
12	Right Rear Door	186.6	211	147	202
13	Right Back Panel	195.6	194	173	220

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Large</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>