

## General Information

Date & Time: 10, Sep, 2025 10:09

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	20,217
<b>Registration No.</b>	DBN8961	<b>Chassis No.</b>	PA1B18F39P4234618
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



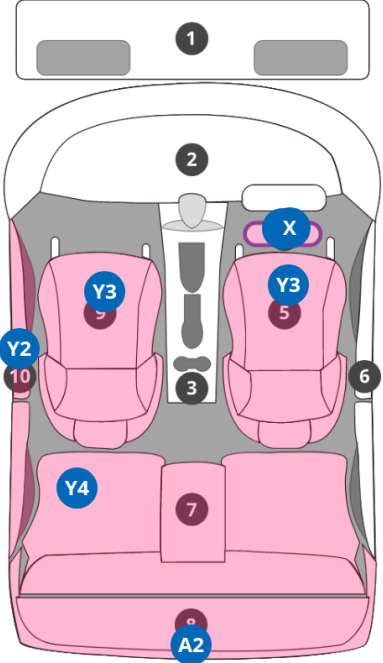
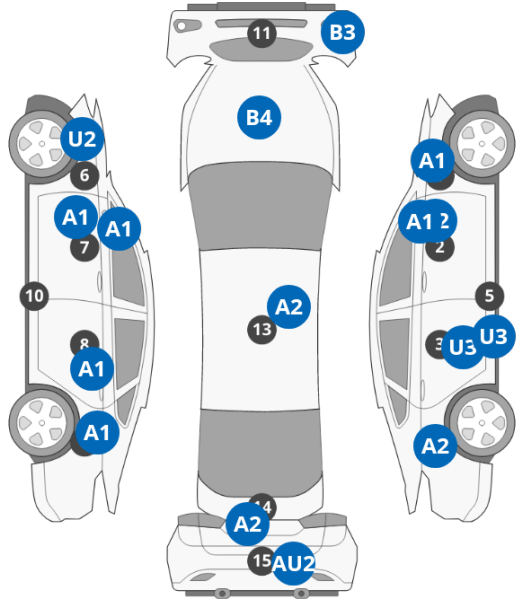
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	112	98	116
2	Boot Lid	112.6	111	116	111
3	Roof	99.8	106	103	94/96
4	Left Front Fender	98.3	95	91	109
5	Left Front Door	99.8	102	94	103
6	Center Panel Left				
7	Left Rear Door	106.4	113	94	112
8	Left Back Panel	109.9	124	110	96
9	Right Front Fender	104.6	108	105	101
10	Right Front Door	108.7	114	98	114
11	Center Panel Right				
12	Right Rear Door	105.3	100	102	114
13	Right Back Panel	107.3	108	102	112

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	C	<b>Exterior Evaluation :</b>	D
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>		<p><b>Remarks</b> Bonnet, Headlight - Modified - Large / Front Bumper, Grille, Lamps - Modified - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal</p>	
<b>Frame Evaluation :</b>	A	<b>Functional Evaluation :</b>	A
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Reverse Camera - N/A - Yes</p>	

<b>Inspector Notes</b>
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, scratches on headlight and tail light