

## General Information

Date & Time: 06, Sep, 2025 11:05

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	14,278
<b>Registration No.</b>	CCC5077	<b>Chassis No.</b>	MHKAA1BCPJ009906
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Yellow		

## Body / Panel Condition



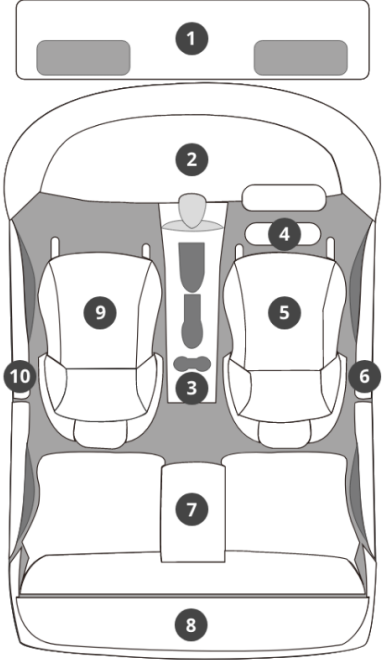
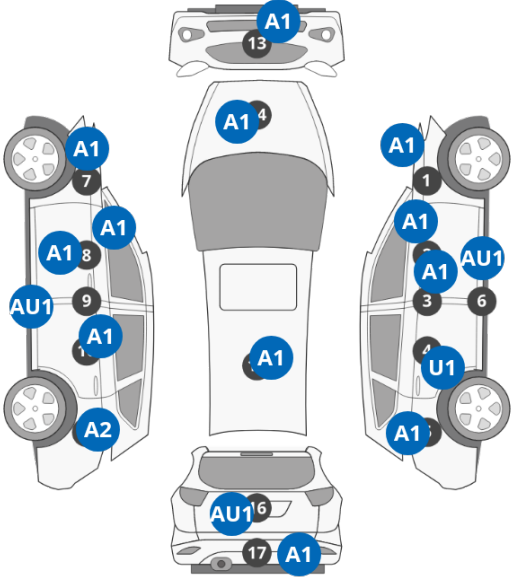
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	107	115	107
2	Boot Lid	90.8	86	94	93
3	Roof	94.3	99	91	94/94
4	Left Front Fender	92.8	93	96	91
5	Left Front Door	105.3	100	100	116
6	Center Panel Left				
7	Left Rear Door	92.2	100	94	83
8	Left Back Panel	91.5	97	89	89
9	Right Front Fender	94.6	99	96	89
10	Right Front Door	100.6	107	100	95
11	Center Panel Right				
12	Right Rear Door	100.0	95	109	97
13	Right Back Panel	92.4	95	86	97

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Defects not found	<b>Remarks</b> (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet and scratch headlight and tail. adhesive marks on Side mirror.