

General Information

Date & Time: 02, Mar, 2026 17:49

Make	Toyota	Model	Hilux
YOM	2014	Odo Meter Reading	268,956
Registration No.	AAC9646	Chassis No.	MR0FZ29G802532422
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



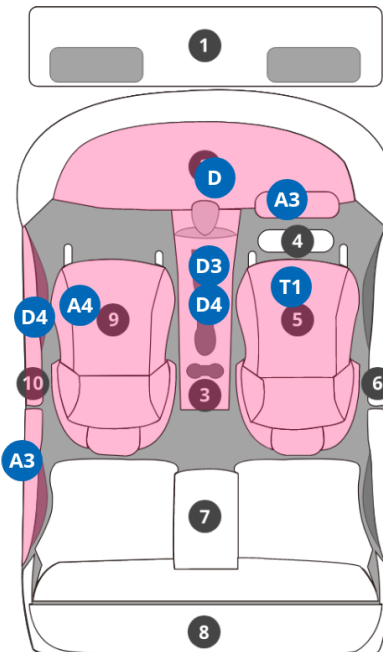
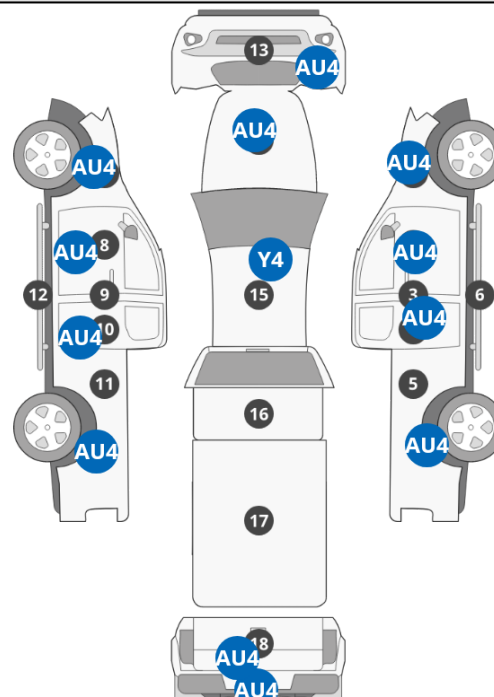
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	108	112	127
2	Boot Lid	126.6	118	137	125
3	Roof	108.8	100	87	119/130
4	Left Front Fender	91.5	87	97	91
5	Left Front Door	108.6	104	112	110
6	Center Panel Left				
7	Left Rear Door	115.0	117	114	114
8	Left Back Panel	134.6	123	149	132
9	Right Front Fender	95.4	90	94	102
10	Right Front Door	123.3	141	124	105
11	Center Panel Right				
12	Right Rear Door	128.6	115	123	148
13	Right Back Panel	121.6	133	128	104

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / (L) Front Seat - Cut, Crack - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Rear Trim - Cut, Crack - Medium / (L) Front Trim - Worked - Large / Console, Switches, Vents - Loose, Deformed - Medium / (R) Front Seat - Cigarette Burns - Burnt Minimal / Console, Switches, Vents - Worked - Large / Glove Box - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Large / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Worn as per age - Yes / Front Windshield - Damaged - Large</p>
Frame Evaluation : C	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Frame - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no jack and tools/ radio issue/ battery issue/ possible flooding/ fog light issue/ plate light issue/ rear gate issue/ with LTO plate and sparetire</p>