

## General Information

Date & Time: 10, Sep, 2025 15:45

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	22,804
<b>Registration No.</b>	DBQ4197	<b>Chassis No.</b>	MHKAA1BC7RJ020581
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Silver		

## Body / Panel Condition



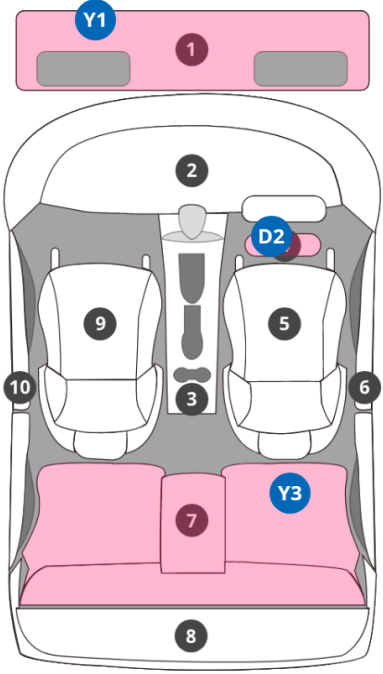
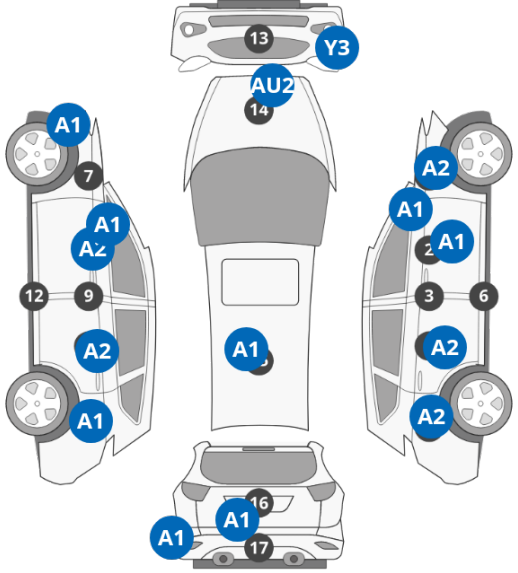
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	183.3	191	189	170
2	Boot Lid	133.6	145	121	135
3	Roof	151.0	171	156	148/129
4	Left Front Fender	104.6	121	109	84
5	Left Front Door	183.3	179	174	197
6	Center Panel Left				
7	Left Rear Door	175.6	194	176	157
8	Left Back Panel	160.3	160	159	162
9	Right Front Fender	169.6	177	179	153
10	Right Front Door	179.0	207	168	162
11	Center Panel Right				
12	Right Rear Door	174.0	154	171	197
13	Right Back Panel	162.0	153	169	164

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Rear Seat - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Floor Mat - Worked - Small	<b>Remarks</b> (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal / Overall Exterior - Full Re-Paint in same color - Yes
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Defects not found

<b>Inspector Notes</b>
with warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on headlight and tail light