

## General Information

Date & Time: 10, Sep, 2025 14:50

Make	Suzuki	Model	Dzire
YOM	2024	Odo Meter Reading	33,953
Registration No.	NKA6767	Chassis No.	MBHZF63S2RG481972
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

## Body / Panel Condition



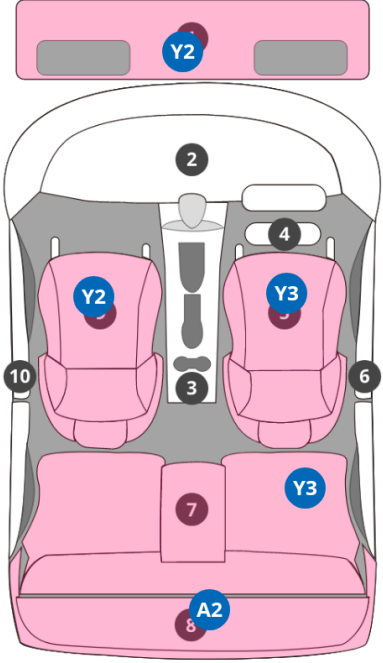
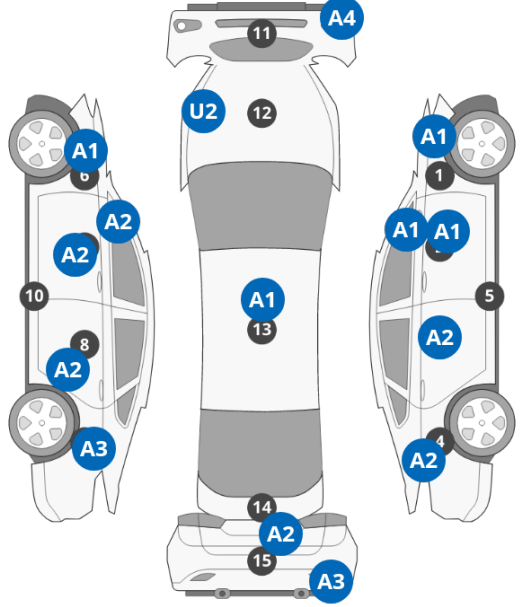
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	101	103	96
2	Boot Lid	79.5	79	85	75
3	Roof	102.3	95	97	107/110
4	Left Front Fender	96.8	87	100	104
5	Left Front Door	96.4	100	96	93
6	Center Panel Left				
7	Left Rear Door	98.8	101	117	79
8	Left Back Panel	92.3	93	98	86
9	Right Front Fender	101.5	103	102	100
10	Right Front Door	94.6	93	95	95
11	Center Panel Right				
12	Right Rear Door	89.4	84	89	96
13	Right Back Panel	99.8	97	107	96

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Minimal / Bonnet, Headlight - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, scratches on headlight and tail light</p>