

General Information

Date & Time: 10, Sep, 2025 13:44

Make	Mitsubishi	Model	L300
YOM	2015	Odo Meter Reading	197,580
Registration No.	ABL2872	Chassis No.	PAEL65MYFFB016523
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Commercial Vehicles
Colour	White		

Body / Panel Condition



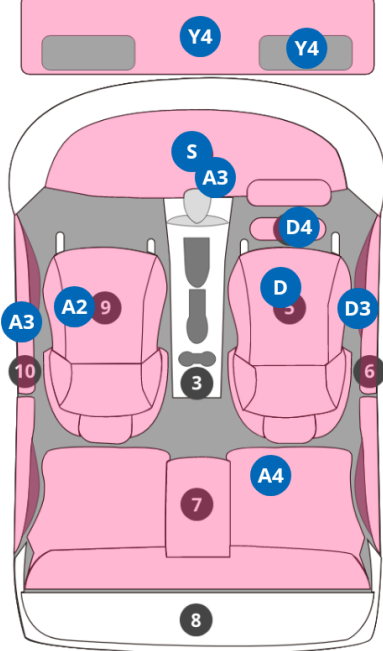
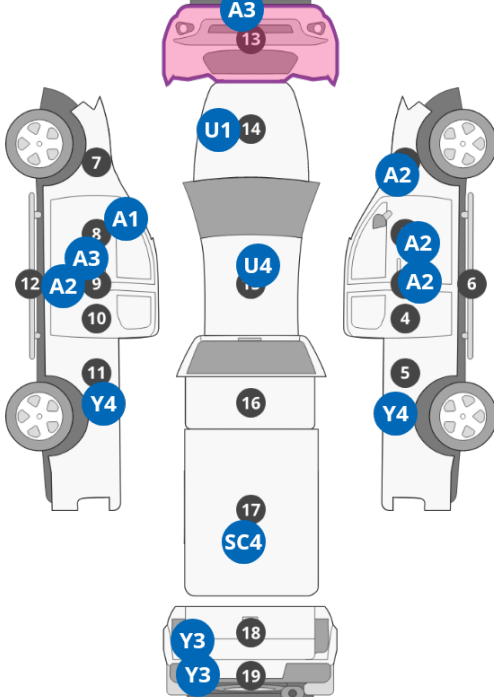
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	220.6	325	166	171
2	Boot Lid	123.3	130	111	129
3	Roof	76.1	73	77	76/79
4	Left Front Fender	205.6	213	205	199
5	Left Front Door	132.3	135	128	134
6	Center Panel Left	143.3	128	157	145
7	Left Rear Door				
8	Left Back Panel	223.0	146	288	235
9	Right Front Fender	220.3	160	164	337
10	Right Front Door	257.3	266	237	269
11	Center Panel Right	152.3	130	163	164
12	Right Rear Door				
13	Right Back Panel	194.0	191	178	213

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	E	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Rear Seat - Cut, Crack - Large / Ceiling - Grime - Large / Carpet - Worked - Large / (R) Front Trim - Loose, Deformed - Medium / (R) Front Seat - Worn - Yes / (L) Front Seat - Cut, Crack - Small / Sunvisor, Sunglass Holder - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Cut, Crack - Medium</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Side Gate - Crack, Gap - Large / Cargo Bed Floor - Rust, Corrosion - Large / Rear Gate - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Side Gate - Crack, Gap - Large / (L) Front Door, Molding - Scratch - Medium / (L) Center Panel - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Dent - Minimal / Roof - Dent - Large / Overall Exterior - Worn as per age - Yes</p>	
Frame Evaluation :	A	Functional Evaluation :	D
<p>Remarks Defects not found</p>		<p>Remarks Panel, Meter - Issue - Yes / Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes</p>	

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, with LTO plate, air-con issue, room lamp issue, panel meter issue, windshield wiper issue, seat belt issue, door issue