

## General Information

Date & Time: 30, Sep, 2025 13:33

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	41,517
<b>Registration No.</b>	NHQ3750	<b>Chassis No.</b>	PA1B18F38R4239845
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



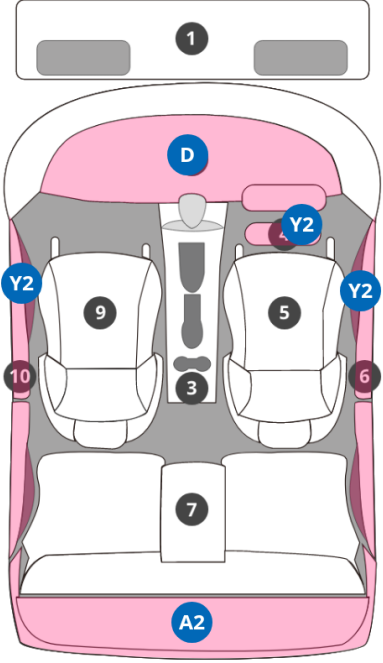
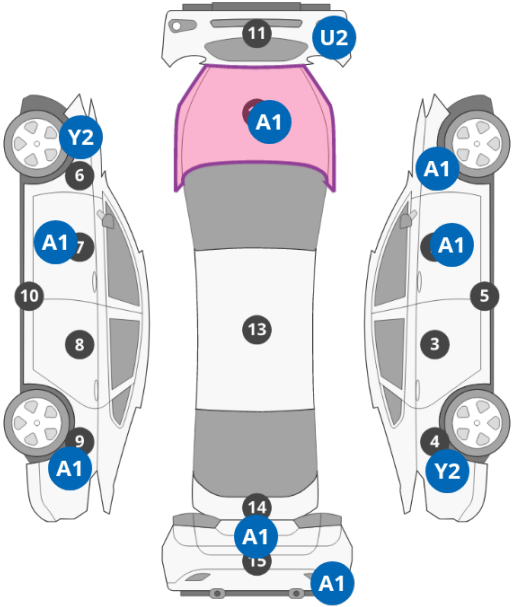
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	336.3	187	630	192
2	Boot Lid	97.8	96	99	99
3	Roof	126.5	137	125	119/125
4	Left Front Fender	97.7	99	94	100
5	Left Front Door	96.0	94	98	96
6	Center Panel Left				
7	Left Rear Door	127.6	128	130	125
8	Left Back Panel	106.3	111	108	100
9	Right Front Fender	96.3	101	95	93
10	Right Front Door	97.8	100	98	96
11	Center Panel Right				
12	Right Rear Door	103.3	95	100	115
13	Right Back Panel	95.2	92	99	95

**Overall Evaluation :**

**B**

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> Bonnet - Repair Traces - Yes / Front Bumper, Grille, Lamps - Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Crack, Gap - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Fender, Molding - Crack, Gap - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with jack and tools/with reverse camera/with warranty booklet/No spare key/open muffler</p>