

## General Information

Date & Time: 29, Sep, 2025 14:33

<b>Make</b>	Toyota	<b>Model</b>	Veloz
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	5,030
<b>Registration No.</b>	NKN7149	<b>Chassis No.</b>	MHFAB1BY5R3128158
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	Red		

## Body / Panel Condition



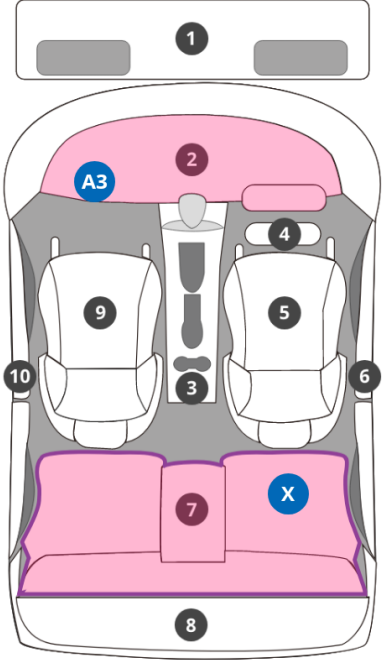
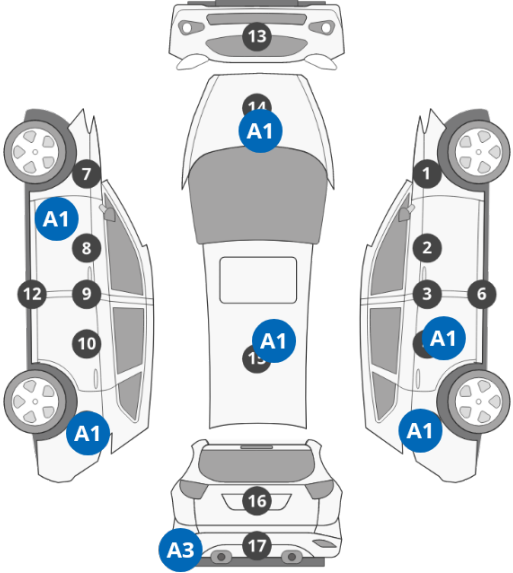
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.5	97	91	111
2	Boot Lid	100.3	96	101	104
3	Roof	117.7	118	111	118/124
4	Left Front Fender	99.6	102	93	104
5	Left Front Door	115.0	105	114	126
6	Center Panel Left				
7	Left Rear Door	107.0	109	105	107
8	Left Back Panel	121.0	134	119	110
9	Right Front Fender	98.5	95	98	103
10	Right Front Door	111.0	113	111	109
11	Center Panel Right				
12	Right Rear Door	107.3	108	104	110
13	Right Back Panel	115.0	100	113	132

**Overall Evaluation :**

B

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Rear Seat - Missing - Yes / Steering Wheel - Worn, Peel, Crack - Medium	<b>Remarks</b> Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Warning Lamps - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes

<b>Inspector Notes</b>	
With LTO plate and Sparetire and Warranty booklet, No Tools and Jack, No wiper arm, rear seat missing, warning lamps on airbag, steering wheel replaced,	