


## General Information

Date & Time: 02, Oct, 2025 09:59

<b>Make</b>	Mitsubishi	<b>Model</b>	Xpander
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	13,711
<b>Registration No.</b>	NIM3823	<b>Chassis No.</b>	MK2LRNC1WPN01865
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Gray		

## Body / Panel Condition

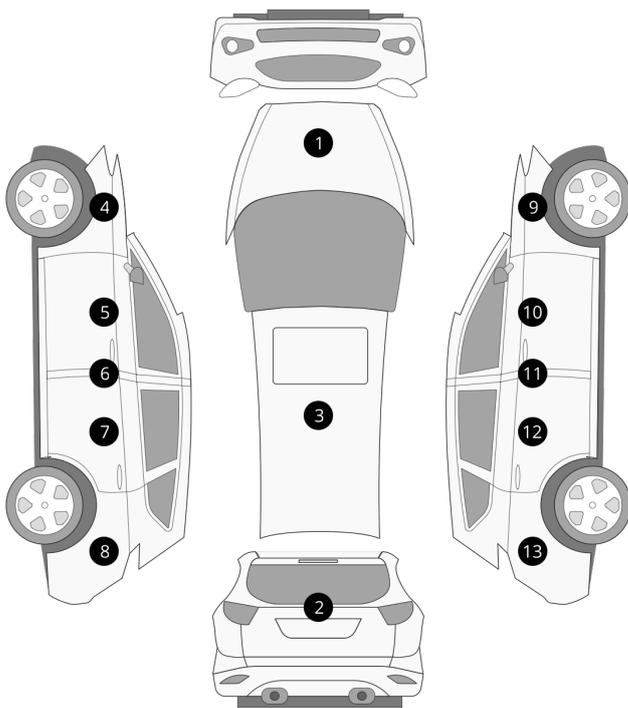

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.4	100	92	109
2	Boot Lid	122.6	122	131	115
3	Roof	104.6	122	101	96/99
4	Left Front Fender	87.5	97	86	80
5	Left Front Door	170.3	175	163	173
6	Center Panel Left				
7	Left Rear Door	170.6	171	157	184
8	Left Back Panel	115.3	120	113	113
9	Right Front Fender	89.2	81	87	100
10	Right Front Door	93.5	88	95	98
11	Center Panel Right				
12	Right Rear Door	91.4	95	88	92
13	Right Back Panel	101.2	108	97	99

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 1.5em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 1.5em;">C</span>
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Small / (R) Rear Trim - Cut, Crack - Minimal / Ceiling - Grime - Small</p>	<p><b>Remarks</b> (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-size: 1.5em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 1.5em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<b>Inspector Notes</b>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, with warming lamp</p>