

General Information

Date & Time: 01, Oct, 2025 10:59

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	53,659
Registration No.	NHC8235	Chassis No.	PA2JA8EM6N0118668
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



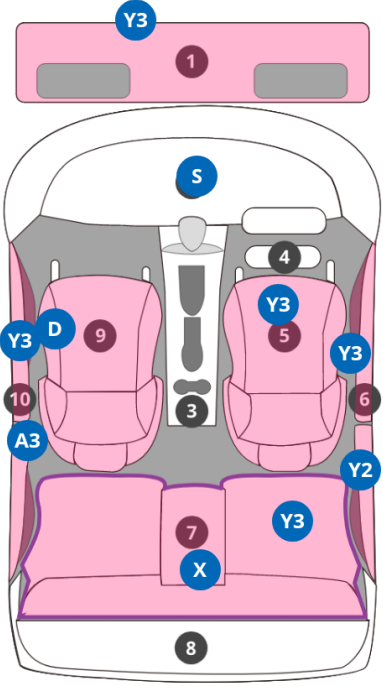
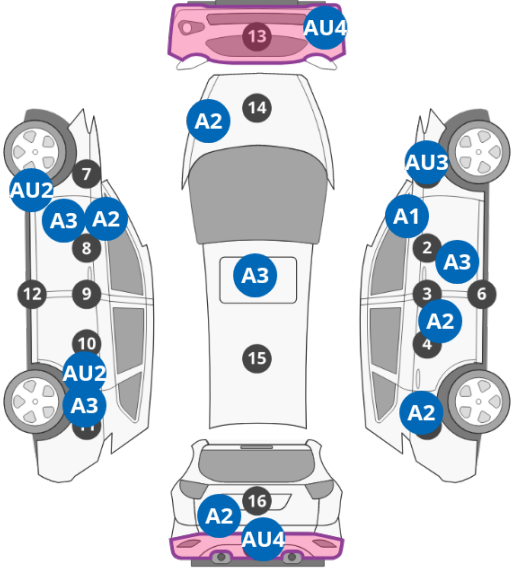
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	107	106	107
2	Boot Lid	103.0	103	103	103
3	Roof	113.5	103	109	139/103
4	Left Front Fender	102.8	105	100	104
5	Left Front Door	170.3	174	188	149
6	Center Panel Left				
7	Left Rear Door	170.6	175	176	161
8	Left Back Panel	107.0	108	101	112
9	Right Front Fender	102.5	104	100	104
10	Right Front Door	103.0	102	105	102
11	Center Panel Right				
12	Right Rear Door	103.3	102	104	104
13	Right Back Panel	102.6	103	103	102

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Medium / (L) Rear Trim - Cut, Crack - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / Rear Seat Head Rest - Missing - Yes / Ceiling - Grime - Medium / Rear Seat - Grime - Medium</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on headlight and tail light, possible flooding, fog lamps issue, 3rd row seat headrest missing, steering wheel buttons issue</p>