

General Information

Date & Time: 16, Dec, 2024 18:30

Make	Toyota	Model	Veloz
YOM	2023	Mileage	18,602
Registration No.	NIF5506	Chassis No.	MHFAB1BYXN3036554
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



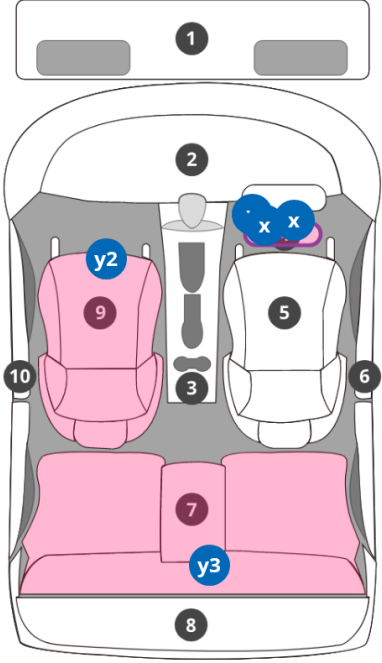
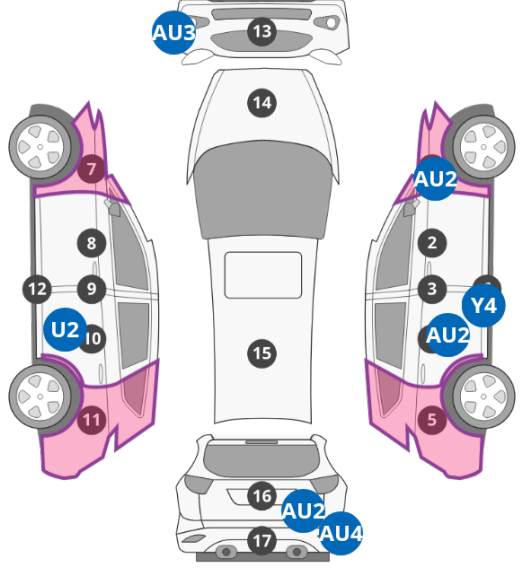
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	98	106	99
2	Boot Lid	106.3	113	111	95
3	Roof	101.5	110	107	91/98
4	Left Front Fender	102.0	94	100	112
5	Left Front Door	100.1	99	95	107
6	Center Panel Left				
7	Left Rear Door	102.4	110	97	100
8	Left Back Panel	114.6	131	111	102
9	Right Front Fender	98.0	96	101	97
10	Right Front Door	97.2	101	92	99
11	Center Panel Right				
12	Right Rear Door	102.6	103	97	108
13	Right Back Panel	120.0	105	127	128

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Partially Missing - Yes / (R) Step, In-panel, Side Spoiler - Crack, Gap - Large / (R) Front Fender, Molding - Partially Missing - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Partially Missing - Yes / (L) Rear Fender, Molding - Partially Missing - Yes / (L) Rear Door, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no tools , spare tire and jack/ with warranty booklet/ molds in the trunk