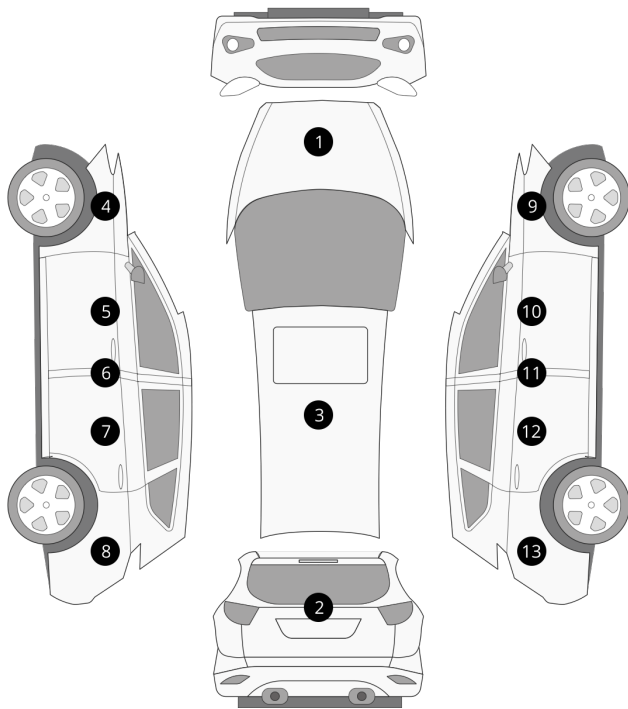


General Information

Date & Time: 17, Dec, 2024 09:40

Make	Toyota	Model	Vios
YOM	2022	Mileage	94,475
Registration No.	NGX5900	Chassis No.	PA1B18F30N4171809
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



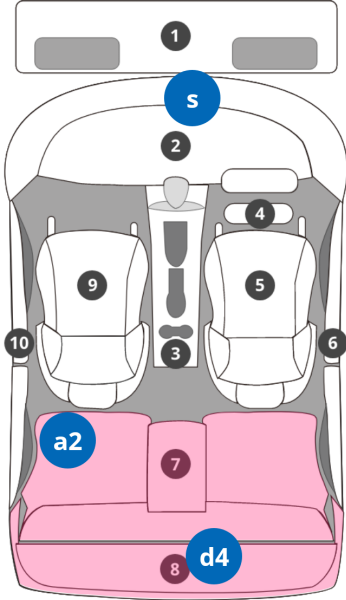
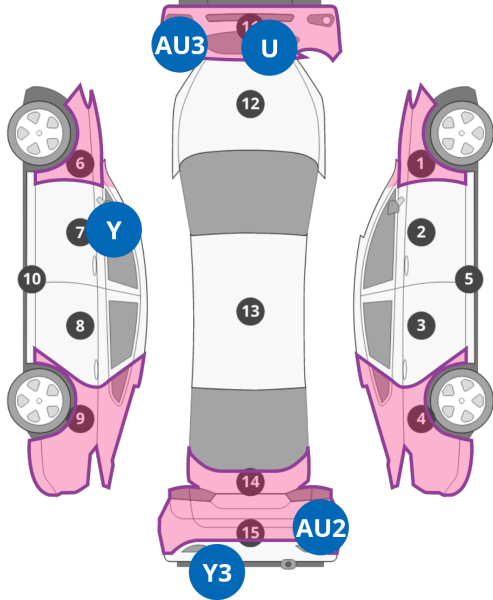
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	260.3	206	310	265
2	Boot Lid	429.0	131	1,023	133
3	Roof	91.5	99	85	88/94
4	Left Front Fender	219.3	246	220	192
5	Left Front Door	97.0	93	103	95
6	Center Panel Left				
7	Left Rear Door	153.6	162	149	150
8	Left Back Panel	117.6	140	111	102
9	Right Front Fender	254.3	178	224	361
10	Right Front Door	88.8	91	89	87
11	Center Panel Right				
12	Right Rear Door	89.7	86	90	94
13	Right Back Panel	212.6	116	364	158

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Loose, Deformed - Large / Rear Seat - Cut, Crack - Small / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Wheel, Cover - Cap Missing - Yes / (L) Mirror - Crack - Damaged / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Repair mark - Difference in Color
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
without warranty booklet/ with spare tire, tools and jack