

## General Information

Date & Time: 29, Oct, 2025 10:25

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	16,945
<b>Registration No.</b>	NJF3329	<b>Chassis No.</b>	MHFAA1BY8R0034800
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Green		

## Body / Panel Condition



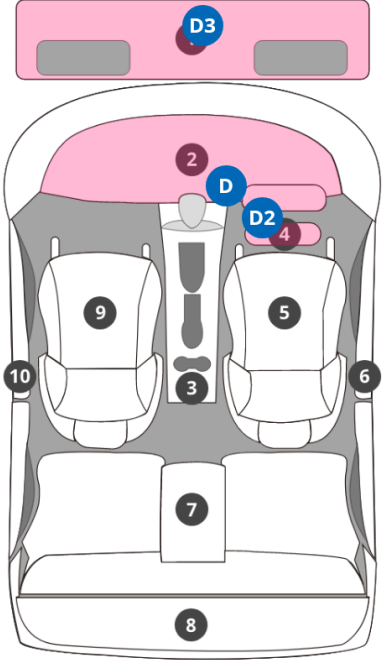
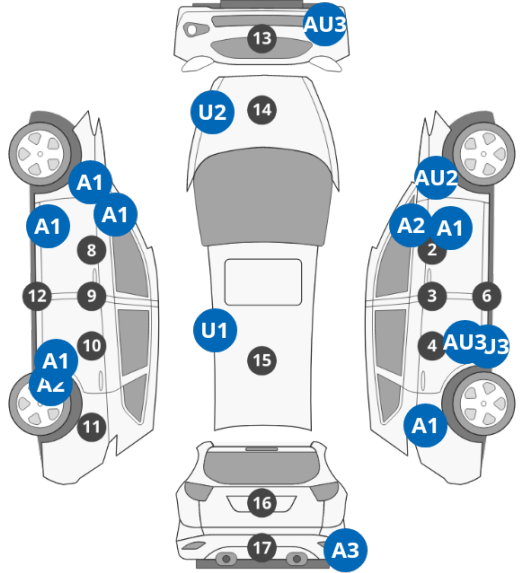
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.4	96	115	111
2	Boot Lid	104.3	100	110	103
3	Roof	120.7	140	133	103/107
4	Left Front Fender	102.3	101	102	104
5	Left Front Door	111.0	107	111	115
6	Center Panel Left				
7	Left Rear Door	109.0	112	102	113
8	Left Back Panel	123.0	117	107	145
9	Right Front Fender	104.6	106	108	100
10	Right Front Door	106.0	111	102	105
11	Center Panel Right				
12	Right Rear Door	109.3	117	108	103
13	Right Back Panel	120.3	131	107	123

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / Ceiling - Crinkle - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Roof - Dent - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>