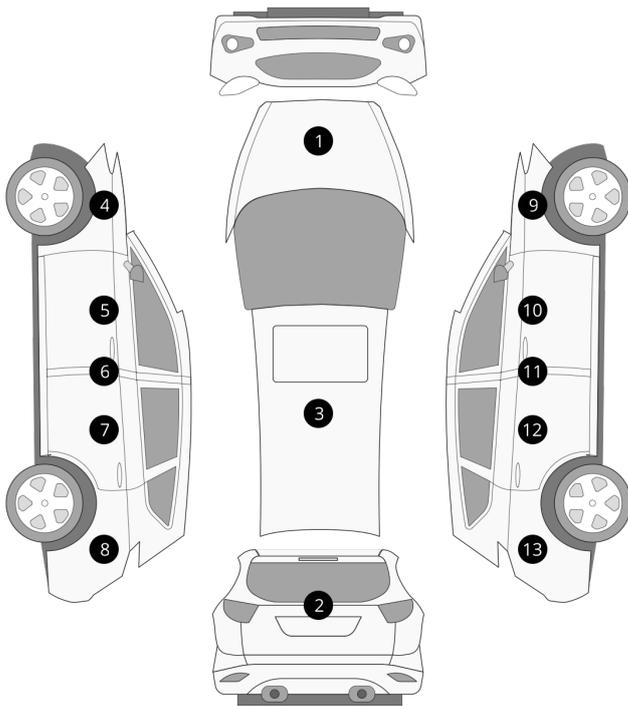


General Information

Date & Time: 04, Oct, 2025 13:20

Make	Toyota	Model	Hilux
YOM	2019	Odo Meter Reading	115,101
Registration No.	NBE4002	Chassis No.	MR0GB8DD1J1419332
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



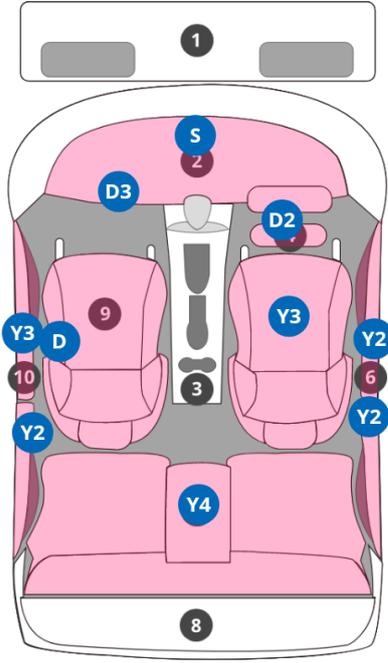
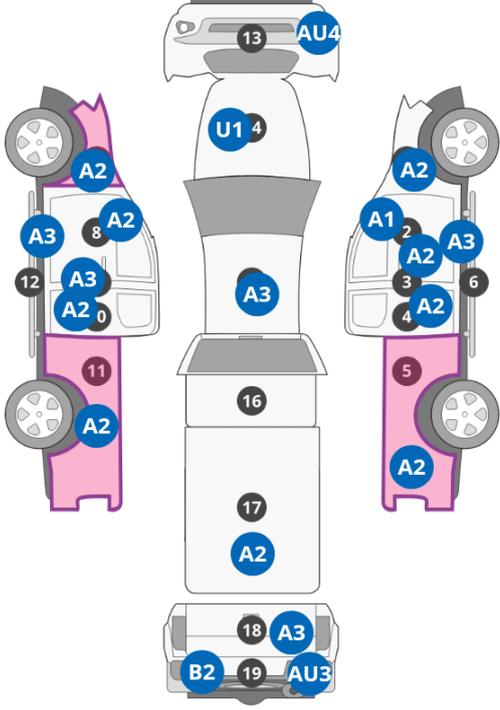
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	172.3	144	137	236
2	Boot Lid	138.6	149	137	130
3	Roof	151.8	321	101	89/96
4	Left Front Fender	160.6	179	186	117
5	Left Front Door	129.3	127	150	111
6	Center Panel Left				
7	Left Rear Door	183.6	184	198	169
8	Left Back Panel	205.3	208	211	197
9	Right Front Fender	245.6	121	142	474
10	Right Front Door	148.6	163	145	138
11	Center Panel Right				
12	Right Rear Door	135.6	134	126	147
13	Right Back Panel	139.6	133	164	122

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Instrument Panel - Loose, Deformed - Medium</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Repair mark - Yes / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Modified - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch - Medium / Cargo Bed Floor - Scratch - Small / (L) Side Gate - Repair mark - Yes / (L) Side Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Minimal / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Air Conditioner - Function - Weak / Remote Key & Smart entry - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate (faded), possible flooding, scratches on headlight and tail light, suncrack taillight, air-conditioning system issue, panel meter issue, plate light issue</p>