


General Information

Date & Time: 04, Oct, 2025 15:17

Make	Mitsubishi	Model	Montero SPT
YOM	2017	Odo Meter Reading	183,103
Registration No.	KAB8614	Chassis No.	MMBGJKR10HH034462
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Red		

Body / Panel Condition

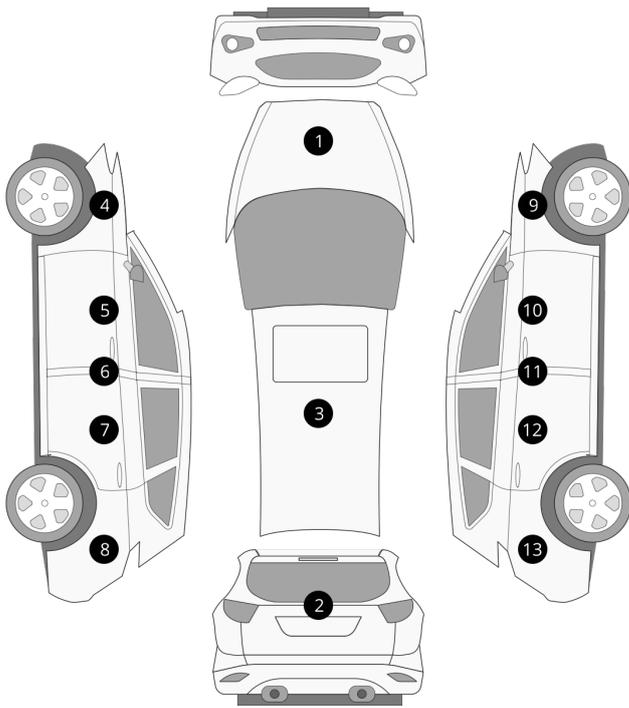

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	255.3	379	239	148
2	Boot Lid	126.0	122	128	128
3	Roof	132.2	123	127	143/136
4	Left Front Fender	230.0	252	244	194
5	Left Front Door	178.6	273	126	137
6	Center Panel Left				
7	Left Rear Door	115.0	114	115	116
8	Left Back Panel	175.0	148	192	185
9	Right Front Fender	146.0	133	146	159
10	Right Front Door	136.3	126	130	153
11	Center Panel Right				
12	Right Rear Door	115.3	108	119	119
13	Right Back Panel	170.6	180	180	152

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (R) Rear Trim - Grime - Medium / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Cut, Crack - Medium / Console, Switches, Vents - Loose, Deformed - Medium / (L) Front Floor Mat - Worked - Small / Trunk Room - Worked - Large / Ceiling - Grime - Large</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Front Windshield - Scratch, Stone chip - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / Overall Exterior - Worn as per age - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Rust, Corrosion - Large / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Rust, Corrosion - Large / Antennae - Damaged - Yes / Roof - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Modified - Small / (R) Rear Fender, Molding - Modified - Small / Bonnet, Headlight - Scratch - Minimal / Bonnet, Headlight - Modified - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack headlights and tail light, possible flooding, horn issue, fog lamps issue, cracked foglamps, cracked front windshield, no reverse light, plate light issue, driver's window stuck, worn tires, all door handle corroded</p>