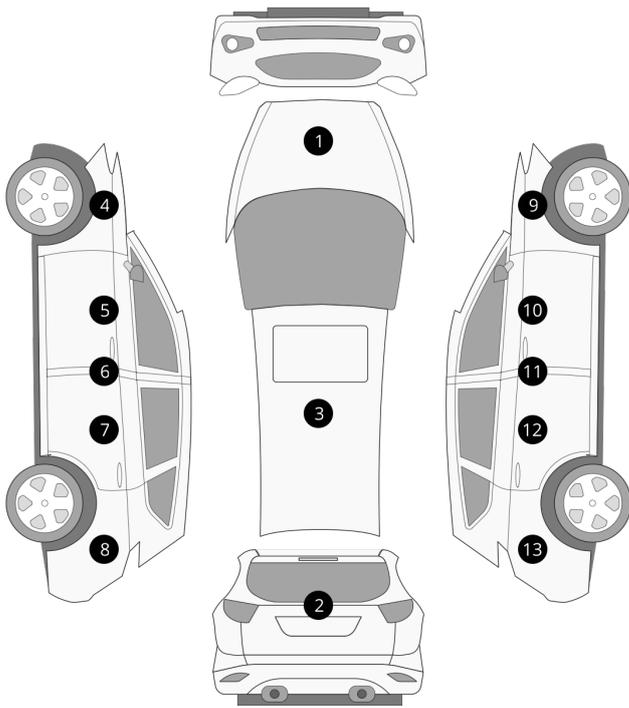


## General Information

Date & Time: 06, Oct, 2025 17:28

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	32,668
<b>Registration No.</b>	DAS7913	<b>Chassis No.</b>	PA1B18F31N4195228
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



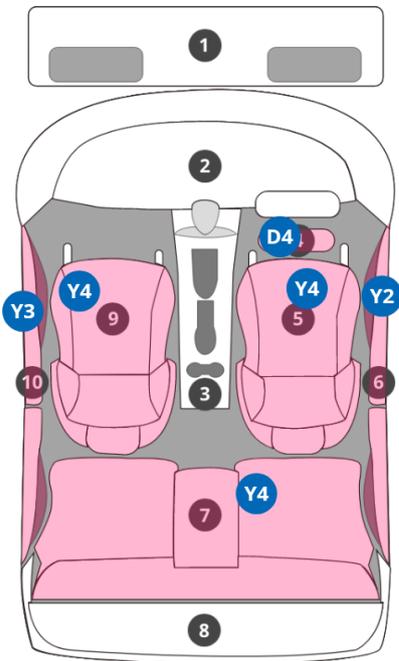
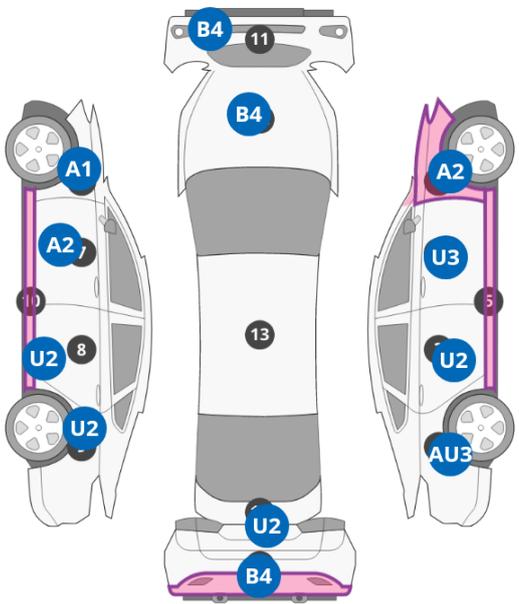
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>102.3</b>	103	102	102
2	Boot Lid	<b>110.3</b>	110	110	111
3	Roof	<b>100.6</b>	104	103	100/96
4	Left Front Fender	<b>121.0</b>	133	116	114
5	Left Front Door	<b>106.6</b>	112	106	102
6	Center Panel Left				
7	Left Rear Door	<b>107.0</b>	107	110	104
8	Left Back Panel	<b>112.0</b>	118	107	111
9	Right Front Fender	<b>182.0</b>	148	212	186
10	Right Front Door	<b>100.8</b>	98	100	105
11	Center Panel Right				
12	Right Rear Door	<b>104.5</b>	112	100	102
13	Right Back Panel	<b>108.3</b>	105	100	120

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (L) Front Floor Mat - Worked - Large</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Dent - Medium / (R) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Modified - Large / Rear Bumper, Lamps, Panels - Modified - Large / (L) Rear Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Modified - Large / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet and LTO plate/ with spare tire/ no tools and jack/</p>