

## General Information

Date & Time: 09, Oct, 2025 13:28

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2025    | Odo Meter Reading | 9,117             |
| Registration No. | DBR1167 | Chassis No.       | PA1B18F35R4271300 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Silver  |                   |                   |

## Body / Panel Condition



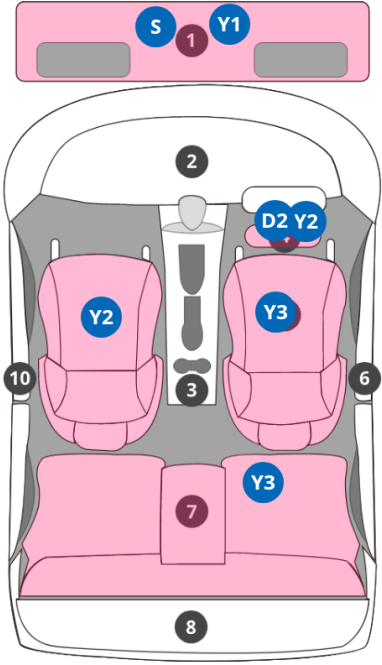
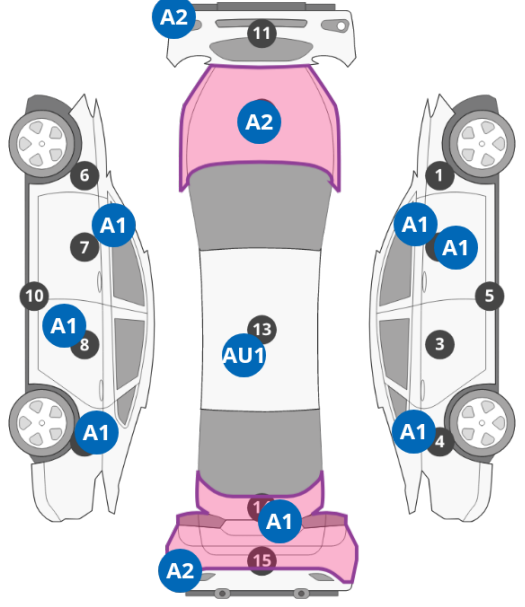
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 171.0         | 178    | 166    | 169      |
| 2  | Boot Lid           | 179.3         | 179    | 180    | 179      |
| 3  | Roof               | 160.2         | 164    | 164    | 154/159  |
| 4  | Left Front Fender  | 153.0         | 156    | 150    | 153      |
| 5  | Left Front Door    | 164.6         | 160    | 173    | 161      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 161.6         | 163    | 166    | 156      |
| 8  | Left Back Panel    | 167.3         | 181    | 157    | 164      |
| 9  | Right Front Fender | 157.0         | 153    | 161    | 157      |
| 10 | Right Front Door   | 152.0         | 150    | 153    | 153      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 162.6         | 164    | 162    | 162      |
| 13 | Right Back Panel   | 163.3         | 168    | 157    | 165      |

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                            | Exterior Evaluation : <b>B</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>        |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                       |
| <b>Remarks</b><br>Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Minimal | <b>Remarks</b><br>Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                               | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                       | <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

| Inspector Notes                                                                                                                   |
|-----------------------------------------------------------------------------------------------------------------------------------|
| With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet and scratch headlight and tail light, foul smell. |