

## General Information

Date & Time: 06, Oct, 2025 15:16

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	38,462
<b>Registration No.</b>	EAJ4775	<b>Chassis No.</b>	MHFAA1BY4R0025902
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



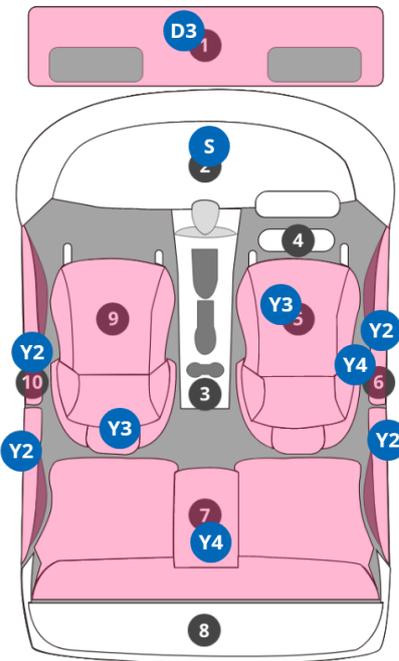
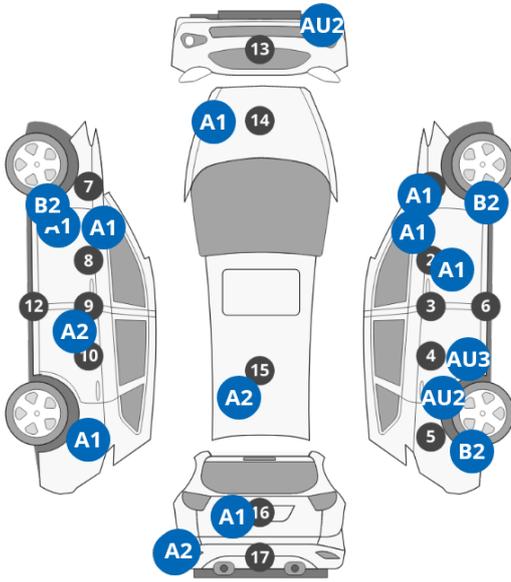
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>118.0</b>	115	117	122
2	Boot Lid	<b>102.6</b>	95	110	103
3	Roof	<b>104.1</b>	92	119	101/104
4	Left Front Fender	<b>99.0</b>	98	101	98
5	Left Front Door	<b>112.6</b>	116	108	114
6	Center Panel Left				
7	Left Rear Door	<b>111.0</b>	113	104	116
8	Left Back Panel	<b>114.7</b>	117	97	130
9	Right Front Fender	<b>95.0</b>	97	95	93
10	Right Front Door	<b>107.6</b>	109	102	112
11	Center Panel Right				
12	Right Rear Door	<b>108.3</b>	111	111	103
13	Right Back Panel	<b>120.3</b>	107	117	137

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / (R) Front Seat belt - Grime - Large / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Crinkle - Medium / (L) Front Seat - Grime - Medium</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Modified - Small / (R) Rear Fender, Molding - Modified - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Modified - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Modified - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, no jack and tools, with spare tire, with LTO plate, possible flooding, scratches on tail light, dome light issue</p>