

General Information

Date & Time: 09, Oct, 2025 13:26

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	52,608
Registration No.	NFA4442	Chassis No.	PA1B18F32P4207938
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



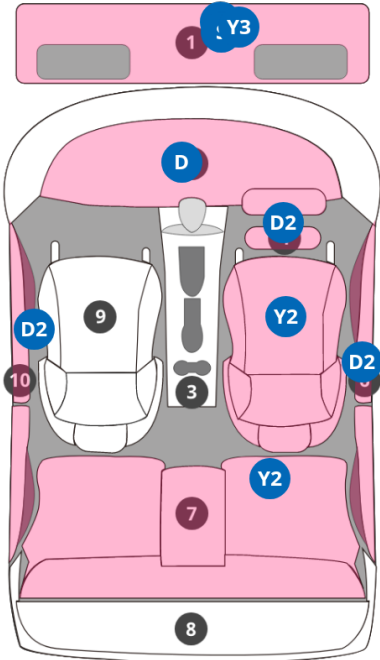
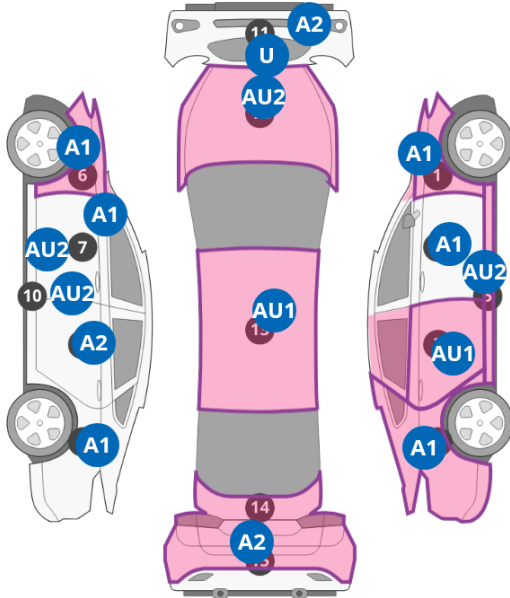
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	272.6	264	255	299
2	Boot Lid	245.3	273	221	242
3	Roof	99.4	109	101	94/94
4	Left Front Fender	255.3	244	257	265
5	Left Front Door	147.0	158	129	154
6	Center Panel Left				
7	Left Rear Door	110.3	121	107	103
8	Left Back Panel	106.3	109	104	106
9	Right Front Fender	232.0	308	181	207
10	Right Front Door	139.3	142	138	138
11	Center Panel Right				
12	Right Rear Door	101.3	100	101	103
13	Right Back Panel	103.8	105	99	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : D	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Overall Interior - Animal Hair - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Medium / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes		Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal	
Frame Evaluation : C		Functional Evaluation : A	
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes		Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist	

Inspector Notes

With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet and No Spare Key, worn tires and Sparetire, Scratch headlight and tail light, no reverse camera, Abnormal vibration on engine.