

General Information

Date & Time: 13, Oct, 2025 10:32

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	13,315
Registration No.	NHJ2229	Chassis No.	MHKA4DF5FPJ081674
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



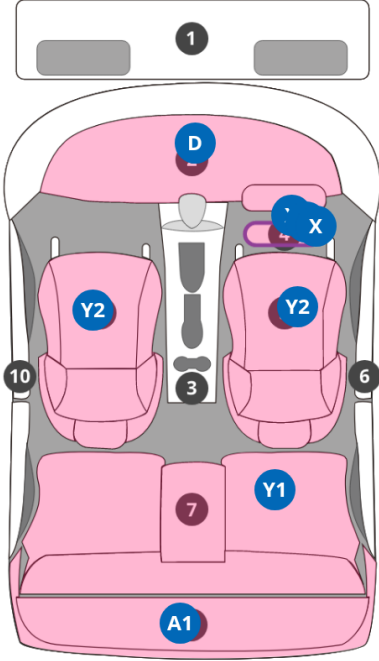
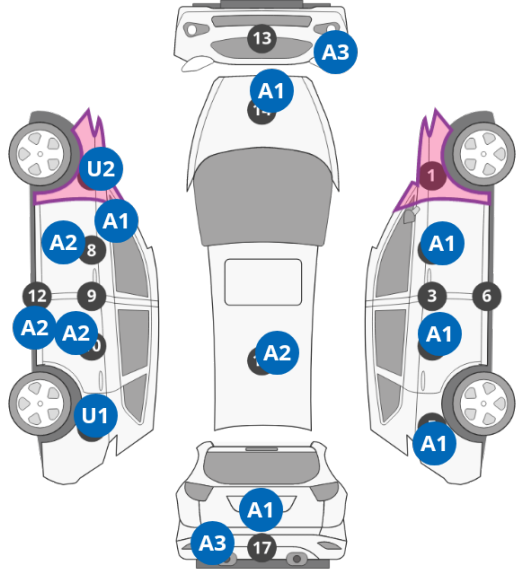
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	123	127	114
2	Boot Lid	102.9	100	106	103
3	Roof	82.2	73	91	82/83
4	Left Front Fender	167.3	168	188	146
5	Left Front Door	101.3	94	112	98
6	Center Panel Left				
7	Left Rear Door	106.6	104	109	107
8	Left Back Panel	96.1	100	102	86
9	Right Front Fender	163.0	138	177	174
10	Right Front Door	121.0	115	125	123
11	Center Panel Right				
12	Right Rear Door	104.1	112	105	95
13	Right Back Panel	101.8	102	100	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with spare tire/with spare key/No jack and No tools/with reverse camera/with warranty booklet/front and rear floor mat missing