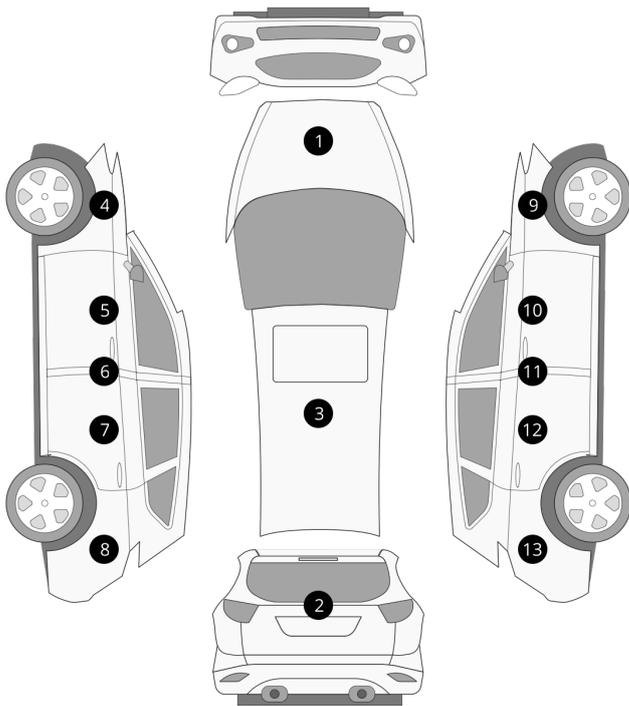


General Information

Date & Time: 06, Oct, 2025 15:46

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	33,307
Registration No.	NIF7695	Chassis No.	MHFAA1BY5N0008004
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



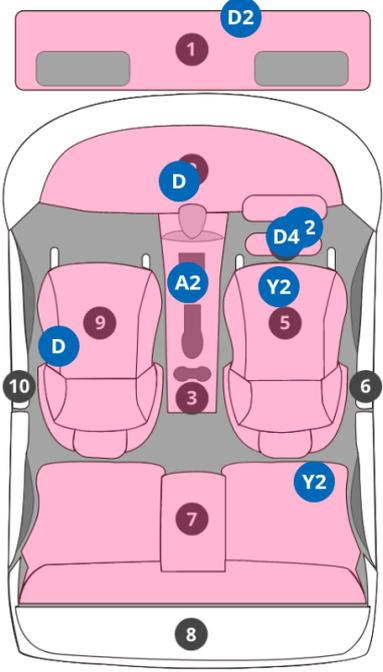
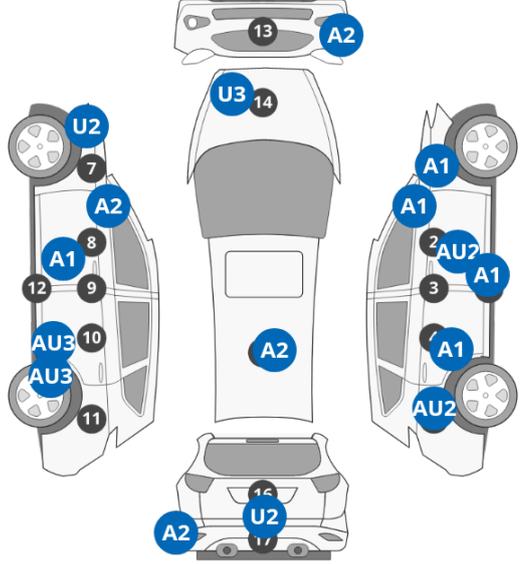
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	132	115	116
2	Boot Lid	197.3	197	199	196
3	Roof	114.2	121	113	110/113
4	Left Front Fender	107.6	109	102	112
5	Left Front Door	116.3	112	110	127
6	Center Panel Left				
7	Left Rear Door	120.0	126	113	121
8	Left Back Panel	114.0	105	104	133
9	Right Front Fender	105.6	109	106	102
10	Right Front Door	110.6	117	106	109
11	Center Panel Right				
12	Right Rear Door	121.3	121	113	130
13	Right Back Panel	120.6	134	102	126

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Crinkle - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / Knobs - Worn, Peel, Crack - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Dent - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>