

General Information

Date & Time: 06, Oct, 2025 18:20

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	20,024
Registration No.	NKB7625	Chassis No.	PA1B18F34R4242127
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



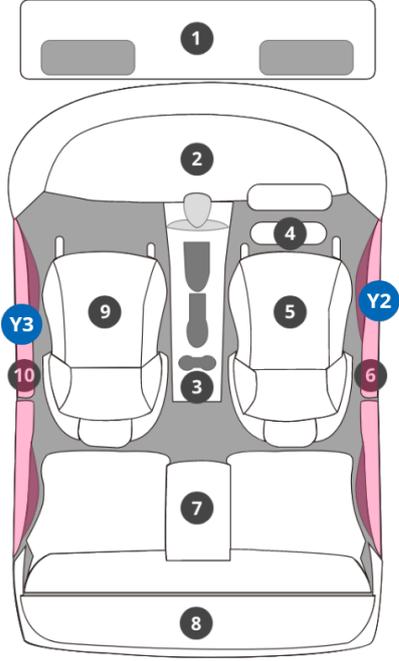
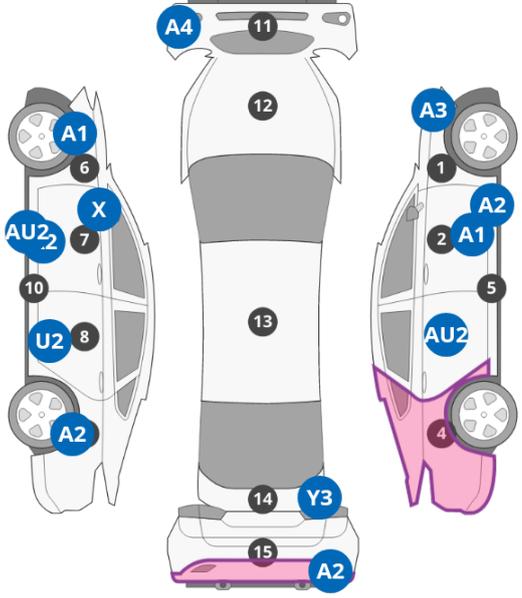
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	118	112	109
2	Boot Lid	171.0	144	181	188
3	Roof	99.4	107	98	99/93
4	Left Front Fender	97.0	98	96	97
5	Left Front Door	102.3	103	108	96
6	Center Panel Left				
7	Left Rear Door	98.0	99	100	95
8	Left Back Panel	210.3	202	234	195
9	Right Front Fender	99.2	98	97	102
10	Right Front Door	102.8	106	103	100
11	Center Panel Right				
12	Right Rear Door	101.9	100	98	108
13	Right Back Panel	205.6	175	278	164

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Rear Door, Molding - Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Stuck - Yes / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium</p>
Frame Evaluation : D	Functional Evaluation : A
<p>Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet and LTO plate/ with jack and spare tire/ with tools/</p>