

General Information

Date & Time: 07, Oct, 2025 08:57

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	4,951
Registration No.	DBS4484	Chassis No.	PA1B18F33R4281338
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



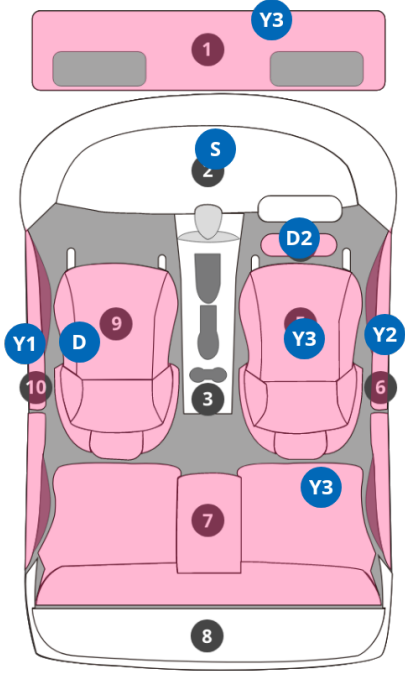
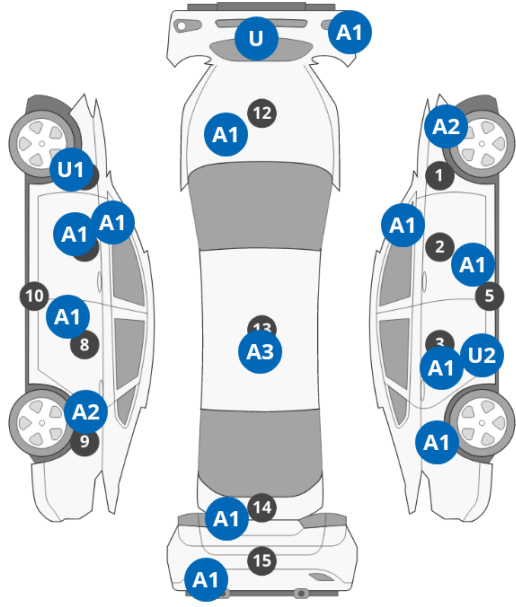
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	171.0	163	182	168
2	Boot Lid	81.7	83	80	82
3	Roof	103.6	107	101	100/107
4	Left Front Fender	88.7	88	90	89
5	Left Front Door	151.0	150	141	162
6	Center Panel Left				
7	Left Rear Door	331.6	180	154	661
8	Left Back Panel	125.4	188	92	97
9	Right Front Fender	145.3	149	138	149
10	Right Front Door	149.0	156	140	151
11	Center Panel Right				
12	Right Rear Door	147.3	137	144	161
13	Right Back Panel	106.2	90	102	127

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Ceiling - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Medium</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, no LTO plate, possible flooding, scratches on tail light,</p>