

General Information

Date & Time: 04, Oct, 2025 16:20

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2025 | Odo Meter Reading | 12,571 |
| Registration No. | NKN9427 | Chassis No. | PA1B18F37S4285592 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Blue | | |

Body / Panel Condition



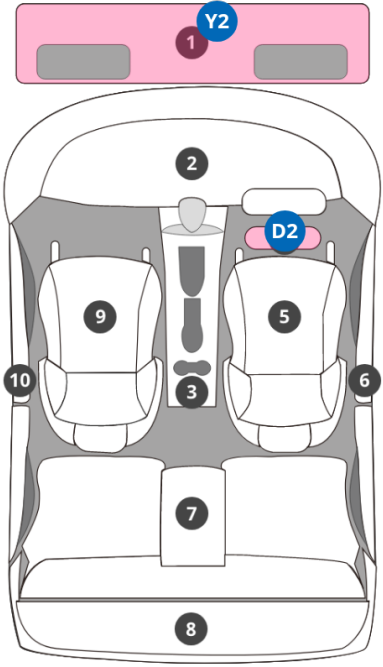
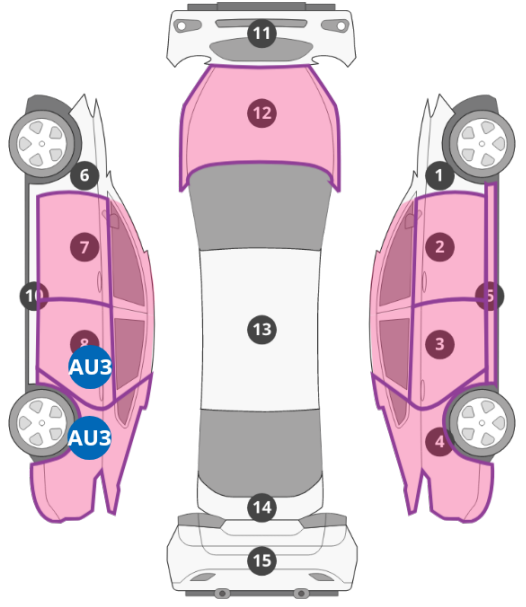
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 108.0 | 105 | 107 | 112 |
| 2 | Boot Lid | 102.6 | 102 | 101 | 105 |
| 3 | Roof | 90.1 | 90 | 97 | 86/88 |
| 4 | Left Front Fender | 92.6 | 99 | 90 | 89 |
| 5 | Left Front Door | 101.6 | 98 | 104 | 103 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 100.8 | 100 | 114 | 89 |
| 8 | Left Back Panel | 101.9 | 105 | 98 | 103 |
| 9 | Right Front Fender | 97.5 | 101 | 100 | 92 |
| 10 | Right Front Door | 101.5 | 98 | 98 | 108 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 96.6 | 95 | 94 | 101 |
| 13 | Right Back Panel | 109.3 | 108 | 108 | 112 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|--|
| Interior Evaluation : A | Exterior Evaluation : C |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small | Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes |
| Frame Evaluation : D | Functional Evaluation : C |
| Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes | Remarks Warning Lamps - Issue - Yes |

Inspector Notes

with LTO plate and Sparetire and Warranty booklet, No Tools and Jack, Abnormal vibration, warning lamps on.